150 AI ASKA

KODIAK

KODIAK (ADQ)(PADQ) P (CG) 4 SW UTC-9(-8DT) N57°44.99′ W152°29.64′

B ARFF Index—See Remarks NOTAM FILE ADQ RWY 08-26: H7534X150 (ASPH-GRVD) S-53, D-110, 2D-150

PCN 70 F/B/Y/T HIRL 0.8% up W

RWY 08: Thid dsplcd 1138'. Hill.

RWY 26: REIL. VASI(V2L)-GA 2.05° TCH 54'. Rgt tfc.

RWY 11-29: H5400X150 (ASPH-GRVD) S-53, D-110, 2D-150

PCN 44 F/B/Y/T HIRL

RWY 11: Thid dsplcd 440'. Trees.

RWY 29: VASI(V2L). Thid dsplcd 556'. Rgt tfc.

RWY 01-19: H5010X150 (ASPH-GRVD) S-53, D-110, 2D-150

PCN 48 F/B/X/U HIRL 0.3% up S

RWY 01: REIL. VASI(V2L)—GA 3.75° TCH 57'. Trees. Rgt tfc.

RUNWAY DECLARED DISTANCE INFORMATION

RWY 08: TORA-7534 TODA-7534 ASDA-7534 LDA-6396 RWY 11: TORA-4960 TODA-4960 ASDA-4960 LDA-4402 RWY 26: TORA-7534 TODA-7534 ASDA-7534 LDA-7534


RWY 29: TORA-4844 TODA-4844 ASDA-4844 LDA-4402

ARRESTING GEAR/SYSTEM RWY 01: EMAS

RWY 08: EMAS

SERVICE: S2 FUEL 100LL, JET A1 LGT ACTVT REIL Rwy 01 and 26; VASI Rwy 01, 26, 29; HIRL Rwy 01-19, 08-26, 11-29; twy lgts-CTAF. Rwy 01 REIL are omnidirectional to accommodate circling apchs. Rwy 01 VASI does not provide obst clearance beyond 2.0 NM from thld, unusable beyond

2 0 NM

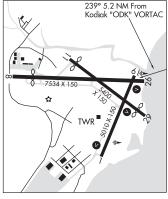

ΚΟΝΙΔΚ H-1B, 2K, L-2J, 3D

IAP. AD

AIRPORT REMARKS: Attended same as arpt maint hrs. For info on arpt call 907-487-4952 Mon-Fri 1600-0130Z‡. TSA regulated airport. See 49 CFR 1542. All gates and doors must be secured at all times. Transient or unfamiliar pilots contact airport mgr with questions. JASU fuel avbl for USCG only. Class I, ARFF Index B. CLOSED to air carrier ops with more than 30 pax seats exc PPR in writing to arpt mgr, P.O. Box 1500 Anton Larson Road, Kodiak, AK 99615. Personnel and egpt may be working on the rwy at any time. No snow removal or deicing for rwy, twy, and ramp, daily 1830-0500 local. Deer, numerous seabirds and migratory waterfowl on and invof arpt. First 3000' Rwy 08 and first 2000' Rwy 01, and associated twys not visible from twr. Portions of all twys not visible from tower due to terrain. Fld surrounded by mountains exc east. High terrain around arpt is not obst lgtd. Mountain on apch to Rwy 08. Recommend use of Rwy 08 only by pilots familiar with terrain. Maneuvering for apch to Rwy 01, Rwy 26, Rwy 29, or Rwy 19, must be accomplished east of afld. Takeoff Rwy 26 or Rwy 29 or Indg Rwy 08 or Rwy 11 not recommended drg hrs of darkness or when mtn peaks are obscd. Pilots are cautioned to thoroughly understand standard instrument apch, and missing apch procedures. Acft ops during ATCT closure: All pilots must be alert when landing Rwy 26 or departing Rwy 08 due to possible tall vessels crossing the Rwy 26 apch corridor 3200' to 5000' from apch end of Rwy 26. Ships over 120' above water cross channel btwn Puffin Island/ADQ. Can occur anytime. Arpt svc road within 50 ft of thid on all rwys. Clsd to Part 121 unscheduled pax carrying ops with over 30 pax seats installed unless 24 hr written notice to arpt mgr and prior apvl received. All tran mil acft contact maintenance on 164.55 or Kodiak Air on 345.0 for Marshaller, 72 hour advance PPR required for access to CG ramp. Transient crew must provide technical/direct/assistance in svc/maint. Expect delays other times except SAR and Medevac V487-5889 C907-487-5889. All arr acft ctc Kodiak Air on 345.0 or 164.55 for clearance onto CG ramp, Marshaller and parking sycs, BE ALERT: Twy to CG ramp crosses two roadways, activate crossing lights key 122.8 5 times on, 7 times off. BE ALERT: Non-standard taxi line obst clearance on CG ramp. All Lifeflight/Medvac acft must use ramp area in or adjacent to transient parking on east side of commercial ramp, outside of SIDA markings. CG ramp unsuitable for acft larger than a C130 wingspan (132.5'). Arpt sand larger gradation than FAA recommended/see AC150/5200-30. Heavy lift cargo acft restricted from full power takeoff on Rwy 08 unless prior authorization from arpt mgmt. Locked wheel turns prohibited on all sfcs. NWS weather balloon launch facility located on arpt, see inside back cover for opn details. Acft weighing more than 200,000 gross takeoff and landing, PPR for all operations.

AIRPORT MANAGER: 907-487-4952

WEATHER DATA SOURCES: ASOS (907) 487-2442 (WX CAM)

COMMUNICATIONS: CTAF 119.8 UNICOM 122.8 ATIS 134.45

RC0 119.8 (KENAI FSS)

WOODY ISLAND RCO 122.2 (KENAI FSS)

ANCHORAGE CENTER APP/DEP CON 281.4 125.1

TOWER 239.0 119.8 (Oct 1-Mar 31 1530-0500Z‡, Apr 1-Sep 30 1600-0700Z‡.) GND CON 121.9

COAST GUARD AIR OPERATIONS (KODIAK AIR) 345.0 156.8 2182 2678

CONTINUED ON NEXT PAGE

CONTINUED FROM PRECEDING PAGE

AIRSPACE: CLASS D svc 1530-0500Z‡ 1 Oct-31 Mar, 1600-0700Z‡ 1 Apr-30 Sep; other times CLASS E. RADIO AIDS TO NAVIGATION: NOTAM FILE ADQ.

(H) (H) VORW/DME 117.1 ODK Chan 118 N57°46.50′ W152°20.39′ 239° 5.2 NM to fld. 133/14E. VOR unusable:

190°-310° bvd 15 NM blo 12.000′

DME unusable:

154°-265° byd 15 NM blo 12,000°

2669-3059

306°-341° byd 15 NM blo 12,000°

WOODY ISLAND NDB (HW) 394 RWO N57°46.49′ W152°19.48′ 241° 5.6 NM to fld. 24/14E.

ILS/DME 110.9 I-ADQ Chan 46 Rwy 26. Class IA. Front unusable within 2.0 DME (0.7 NM from thld). LOC unusable bvd 30° r of course.

COMM/NAV/WEATHER REMARKS: For a toll free call to Kenai FSS dial 1-866-864-1737. RCO available when twr closed.

KODIAK (LILLY LAKE) SPB (9Z3) 1 NE UTC-9(-8DT) N57°48.16′ W152°22.96 KODIAK

KODIAK

130 LRA NOTAM FILE ENA

WATERWAY NE-SW: 2100X250 (WATER)

WATERWAY NE: Rgt tfc.

SEAPLANE REMARKS: Unattended. Arpt clsd at ngt. Arpt CLOSED High/Low wing except 49' and under. Ctc Kodiak Twr 119.8. Windsock located at Kodiak Muni Arpt. Numerous unlit obstructions in vicinity. Be alert possible conflicting traffic with NE operations and lake based acft. Land around lake is private property. All docks and ramps are privately owned.

AIRPORT MANAGER: 907-486-8060

COMMUNICATIONS: CTAF 119.8 UNICOM 122.8 RADIO AIDS TO NAVIGATION: NOTAM FILE ADQ.

(H) (H) VORW/DME 117.1 ODK Chan 118 N57°46.50° W152°20.39′ 306° 2.2 NM to fld. 133/14E.

VOR unusable:

190°-310° bvd 15 NM blo 12.000°

DME unusable:

154°-265° byd 15 NM blo 12,000′

266°-305°

306°-341° byd 15 NM blo 12,000′

COMM/NAV/WEATHER REMARKS: For toll free call to Kenai FSS dial 1-866-864-1737.

G G G G WATER RWY-0 0 0 0 NE-SW 2100 X 250 00 00000 00000000 **43** G G G G G 33 a a a a 43 €3 N ~ CC (3) 0000 Œ *GG G C3 (G) (G 3 0 0 0 0 0 7 0 0 0 0 7 0 0 0 03 03 63 _{છું} હતું ලුලි. ලුලි. ◆ 306° 2.2 NM From ◆ Kodiak "ODK" VORTAC G G

KODIAK MUNI (KDK)(PAKD) 2 NE UTC-9(-8DT) N57°48.36′ W152°22.43

139 NOTAM FILE ENA

RWY 02-20: H2475X40 (ASPH-TRTD)

RWY 02: Thid dspicd 240'. Tree. Rgt tfc.

RWY 20: Trees.

AIRPORT REMARKS: Attended daylight hrs. Arpt unlit and CLOSED for ngt ops. Ctc Kodiak twr for tfc advisory, 119.8. Arpt CLOSED High/Low wing except 49' under. Numerous unlit obstructions in vicinity. Conflicting traffic with Lilly Lake Trident Basin and Kodiak Arpt. Rwy 02-20 surrounded by numerous businesses in close proximity. Rwy 02-20 pavement width varies from 20' wide on Rwy 20 end to 30' wide on Rwy 02 end. Pavement is cracked length of rwy. Rwy 20 road crosses apch 15' blo thid elev 200' from rwy thid. Rwy slopes uphill 67' from Rwy 02 dsplcd thld to Rwy 20, Rwy 02-20 NSTD markings faded to invisible, no line of sight between rwy ends. First 350' of Rwy 02 slopes 5% uphill.

AIRPORT MANAGER: 907-486-8060

COMMUNICATIONS: CTAF 119.8 UNICOM 122.8 RADIO AIDS TO NAVIGATION: NOTAM FILE ADQ.

(H) (H) VORW/DME 117.1 ODK Chan 118 N57°46.50°

W152°20.39' 316° 2.2 NM to fld. 133/14E.

VOR unusable-

190°-310° byd 15 NM blo 12,000°

DMF unusables

154°-265° byd 15 NM blo 12,000′

266°-305°

306°-341° byd 15 NM blo 12,000′

COMM/NAV/WEATHER REMARKS: For a toll free call to Kenai FSS dial 1-866-864-1737.

