

WAAS CH 86912 W10A	APP CRS 094°	Rwy Ldg 6006 TDZE 631 Apt Elev 649
--	------------------------	---

RNAV (GPS) RWY 10


SOUTHWEST MICHIGAN RGNL (BEH)

RNP APCH - GPS.

Rwy 10 helicopter visibility reduction below $\frac{3}{4}$ NM NA. For uncompensated Baro-VNAV systems, LNAV/VNAV NA below -20°C or above 54°C. Baro-VNAV and VDP NA when using LWA altimeter setting. When local altimeter setting not received, use LWA altimeter setting: increase LPV DA to 917 feet and all visibilities $\frac{1}{8}$ SM; increase LNAV/VNAV DA to 1080 feet and all visibilities $\frac{1}{4}$ SM; increase all MDAs 40 feet and LNAV visibility Cats C and D $\frac{1}{2}$ SM.

MISSED APPROACH:
Climb to 2500 direct
GIDPE and hold.

ASOS 121.55	SOUTH BEND APP CON★ 118.55 257.8	CLNC DEL 119.7	UNICOM 123.0 (CTAF) 0
-----------------------	--	--------------------------	---------------------------------

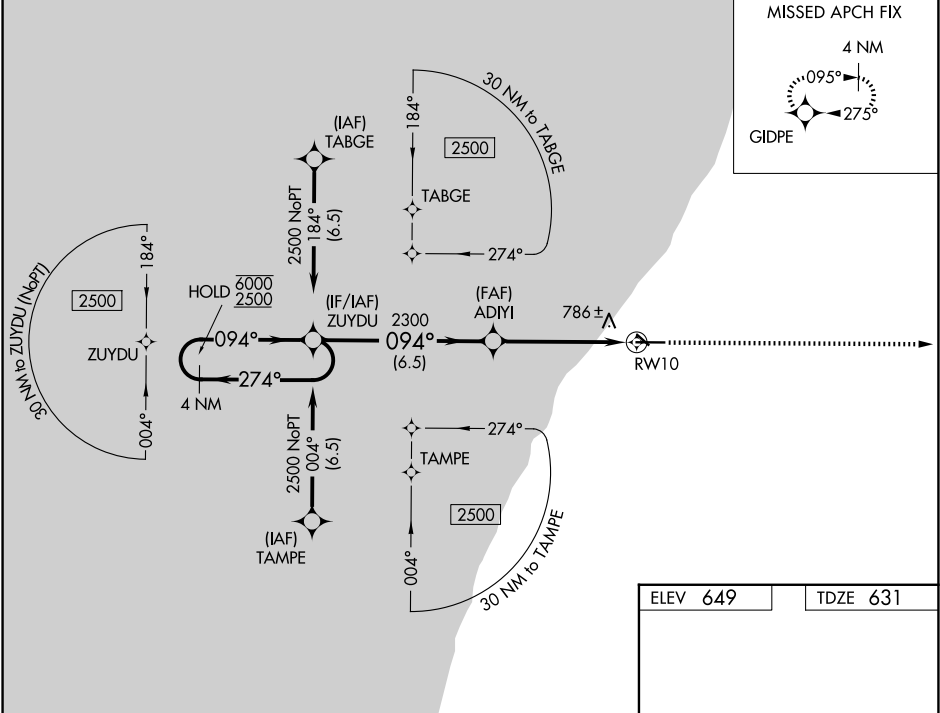

ELEV 649 TDZE 631

4 NM Holding Pattern

VGSI and RNAV glidepath not coincident (VGSI Angle 3.00/TCH 34).

2500

GIDPE

GP 3.00° TCH 40

6000 2500

ZUYDU

ADIYI 2300

1.2 NM to RW10

RW10

6.5 NM

4 NM

1.2 NM

REIL Rws 10, 14 and 32 0

MIRL Rwy 14-32 0

HIRL Rwy 10-28 0