

DEMING MUNI (DMN)(KDMN) 2 SE UTC-7(-6DT) N32°15.74' W107°43.14'

ALBUQUERQUE

4314 B NOTAM FILE DMN MON Airport

H-4K, L-6E

RWY 08-26: H8018X75 (ASPH) S-20 PCN 9 F/D/X/T MIRL

IAP

RWY 08: PAPI(P4L)—GA 3.0° TCH 43'. Brush. 0.3% down.

RWY 26: PAPI(P4L)—GA 3.0° TCH 40'. 0.3% up.

RWY 04-22: H5675X60 (ASPH) S-12 PCN 7 F/D/X/T MIRL

RWY 04: PAPI(P2L)—GA 3.0° TCH 44'.

RWY 22: PAPI(P2L)—GA 3.0° TCH 44'. Brush.

SERVICE: S4 FUEL 100LL, JET A1+ LGT MIRL Rwy 08-26 and PAPI Rwy 08 and Rwy 26 preset low ints 0300-0530Z±, to increase ints ACTIVATE—CTAF.

AIRPORT REMARKS: Attended 1400-0100Z±. For arpt attendant after hrs call 575-494-2311. Emerg acct and powerplant repair avbl call 575-544-3660. No intersection tkfs. Helicopters arriving from East and departing to the East remain North of segmented circle.

AIRPORT MANAGER: 575-544-3660

WEATHER DATA SOURCES: ASOS 118.525 (575) 544-4347.

COMMUNICATIONS: CTAF/UNICOM 122.8

RCO 122.2 (ALBUQUERQUE RADIO)

® **ALBUQUERQUE CENTER APP/DEP CON** 128.2

CLEARANCE DELIVERY PHONE: For CD if una to ctc on FSS freq, ctc Albuquerque ARTCC at 505-856-4561.

AIRSPACE: CLASS E svc 1500-2300Z±; other times CLASS G.

RADIO AIDS TO NAVIGATION: NOTAM FILE DMN.

(L) (L) **VORTACW** 108.6 DMN Chan 23 N32°16.53' W107°36.33' 250° 5.8 NM to fld. 4210/12E.

VOR unusable:

155°-195° byd 15 NM

TACAN AZIMUTH unusable:

155°-195° byd 15 NM


DME unusable:

155°-195° byd 15 NM

COLUMBUS (L) (L) VORW/DME 111.2 CUS Chan 49 N31°49.15' W107°34.47' 333° 27.5 NM to fld. 4008/12E. NOTAM FILE ABQ. VOR/DME unmonitored.

VOR unusable:

335°-342° byd 30 NM blo 10,500'

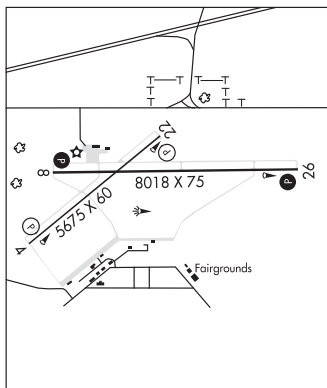

DONA ANA CO INTL JETPORT (See SANTA TERESA on page 380)

DOUBLE EAGLE II (See ALBUQUERQUE on page 352)

DUDLE N35°13.04' W106°42.77' NOTAM FILE AEG.

ALBUQUERQUE

NDB (LOMW) 351 AE 212° 5.9 NM to Double Eagle II. 5455/11E.

DULCE

JICARILLA APACHE NATION (24N) 10 S UTC-7(-6DT) N36°49.71' W106°53.05'

DENVER

7618 B NOTAM FILE ABQ

H-4K, L-8I

RWY 17-35: H7500X75 (ASPH) S-12.5 MIRL 1.1% up S

RWY 17: REIL. PAPI(P2L)—GA 3.0° TCH 30'. Tree.

RWY 35: REIL. PAPI(P2L)—GA 3.0° TCH 30'.

SERVICE: LGT Rwy 17 wind sock lgts OTS indef. ACTIVATE MIRL Rwy 17-35, REIL and PAPI Rwy 17 and Rwy 35—CTAF.

AIRPORT REMARKS: Unattended. Rising terrain in all directions. Wildlife on and invof arpt. Powerline marked and lighted .4 NM west of Rwy 17-35. Rwy 17-35 3+ inch wide random transverse crack approx every 100' for entire rwy length. Main gate locked at all times, ctc arpt manager to enter/exit 505-759-4310. Gate combination 1995.

AIRPORT MANAGER: (575) 759-4310

COMMUNICATIONS: CTAF 122.9

CLEARANCE DELIVERY PHONE: For CD ctc Denver ARTCC at 303-651-4257.

RADIO AIDS TO NAVIGATION: NOTAM FILE FMN.

RATTLESNAKE (H) (H) VORTACW 115.3 RSK Chan 100 N36°44.90' W108°05.93' 071° 58.7 NM to fld. 5821/14E.