

SIMPSON (9W3) 3 S UTC-5(-4DT) N39°05.61' W80°01.55'

1960 NOTAM FILE EKN

RWY 01-19: 1500X50 (TURF)

RWY 01: Road.

RWY 19: Trees.

AIRPORT REMARKS: Attended continuously. Deer on and in vicinity of arpt. Rwy 01 85' tree, 0' dstc, 106' R. Rwy 19 has 50' drop-off 75' dstc. Rwy 01 has 15' public rd across rwy end. Rwy 01 Rwy partially mkd w/white tires. Rwy 01-19 sfc rolling.

AIRPORT MANAGER: 304-457-2323

COMMUNICATIONS: CTAF 122.9

CLEARANCE DELIVERY PHONE: For CD ctc Washington ARTCC at 703-771-3587.

CINCINNATI

PINEVILLE

KEE FLD (I16) 2 NW UTC-5(-4DT) N37°36.03' W81°33.56'

1783 B NOTAM FILE EKN

RWY 08-26: H3701X60 (ASPH) S-13 MIRL 1.6% up E

RWY 08: REIL. Trees.

RWY 26: REIL. Thld dspld 590'. Trees.

SERVICE: FUEL 100LL LGT ACTIVATE MIRL Rwy 08-26 REIL Rwy 08 and Rwy 26—CTAF.

AIRPORT REMARKS: Attended Mon-Fri 1400-2100Z. Unattended major holidays, for arpt attendant after hrs call 304-732-7372 (manager residence). Wildlife on and invof arpt. Birds on and invof arpt. Landfill midpoint of rwy, south side. Rising terrain surrounds arpt.

AIRPORT MANAGER: 304-732-9160

WEATHER DATA SOURCES: AWOS-3 120.625 (304) 732-7311. Wnd unrel.

COMMUNICATIONS: CTAF/UNICOM 122.8

Ⓡ CHARLESTON APP/DEP CON 125.4

CLEARANCE DELIVERY PHONE: For CD ctc Indianapolis ARTCC at 317-247-2411.

RADIO AIDS TO NAVIGATION: NOTAM FILE BKW.

BECKLEY (H) (DH) VOR/DME 117.7 BKW Chan 124 N37°46.82' W81°07.41' 249° 23.4 NM to fld. 2517/6W.

DME unusable:

080°-215° byd 15 NM


VOR unusable:

070°-200°

CINCINNATI

L-26H

IAP

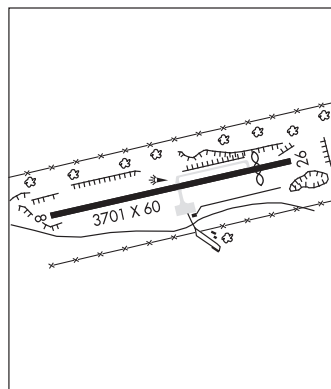

POINT PLEASANT

MASON CO (312) 4 NE UTC-5(-4DT) N38°54.88' W82°05.91'

643 B NOTAM FILE EKN

RWY 07-25: H4000X75 (ASPH) S-24 MIRL 0.3% up SW

RWY 07: REIL. PAPI(P2L)—GA 3.0° TCH 44'. Trees.

RWY 25: REIL. PAPI(P2L)—GA 3.0° TCH 43'. Trees.

SERVICE: FUEL 100LL LGT Actvt REIL Rwy 07 and 25; PAPI Rwy 07 and 25; MIRL Rwy 07-25—CTAF.

AIRPORT REMARKS: Attended 1500-1900Z Mon-Fri. Deer on and in vicinity of arpt. Steam from cooling twrs NW occasionally obscures obstruction lgts on twr North. 100LL self svc. Rwy 07 has 3' ditch 80' L and R of cntrln first 1000'. 6-8' brush parallel to Rwy 25, 95' fm centerline. Portion of ramp and one rwy exit unsafe due to soft weak asph paving. Area marked by lgtd barricade unusable. Cold temperature airport. Altitude correction required at or below -17C. Several power plant stacks in vicinity of arpt west and north. Rwy 25, 35' drop off, 100' fm rwy end.

AIRPORT MANAGER: 304-674-5075

WEATHER DATA SOURCES: AWOS-3 119.675 (304) 675-4618.

COMMUNICATIONS: CTAF/UNICOM 122.8

Ⓡ HUNTINGTON APP/DEP CON 128.4

CLEARANCE DELIVERY PHONE: For CD ctc huntington ATCT at 304-453-2490.

RADIO AIDS TO NAVIGATION: NOTAM FILE EKN.

HENDERSON (H) DME 115.9 HNN Chan 106 N38°45.25' W82°01.57' 341° 10.2 NM to fld. 880.

DME unusable:

185°-290° blo 4,500'

CINCINNATI

L-29B

IAP

