

LANCASTER CO—MC WHIRTER FLD (LKR)(KLLKR) 4 W UTC-5(-4DT) N34°43.37' W80°51.28'

CHARLOTTE

H-9B, 12G, L-24J, 25D, 36E
IAP

486 B NOTAM FILE AND

RWY 06-24: H6004X101 (CONC) S-44, D-60, 2D-118

PCN 15 R/B/X/T MIRL 0.4% up NE

RWY 06: REIL. PAPI(P2L)—GA 3.0° TCH 41'. Thld dsplcd 105'. Tree.

RWY 24: REIL. PAPI(P2L)—GA 3.15° TCH 39'. Tree.

SERVICE: FUEL 100LL, JET A LGT ACTVT REIL Rwy 06 & 24; MIRL Rwy 06-24—CTAF. PAPI Rwy 06 and Rwy 24 opr consly.

AIRPORT REMARKS: Attended 1230-2000Z. Deer on and invof arpt. For fuel after hrs call 803-285-1513. 25' drop, 250' fm thr Rwy 06. Small acft must be on a tie down. Arl applicators not pmtd due to pavement conds. Lndg fee.

AIRPORT MANAGER: (803) 285-1513

WEATHER DATA SOURCES: AWOS-3 120.825 (803) 286-6444.

COMMUNICATIONS: CTAF/UNICOM 122.725

Ⓡ CHARLOTTE APP/DEP CON 120.05

GCO 121.725 (CHARLOTTE APCH)

CLEARANCE DELIVERY PHONE: For CD ctc Charlotte Apch at 704-359-0241.

RADIO AIDS TO NAVIGATION: NOTAM FILE CLT.

CHARLOTTE (L) (L) VOR/DME 115.0 CLT Chan 97 N35°11.42'

W80°57.11' 175° 28.4 NM to fld. 732/5W.

DME portion unusable:

015°-050° byd 25 NM blo 3,000'

050°-100° byd 25 NM blo 2,500'

185°-202° byd 15 NM


203°-220°

270°-350° byd 20 NM blo 5,000'

VOR/DME controlled by Charlotte ATCT

VOR unusable:

203°-220°

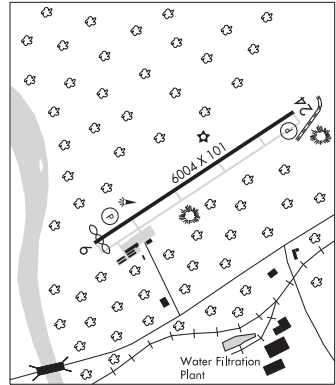

LANDRUM

FAIRVIEW (33A) 3 SE UTC-5(-4DT) N35°09.44' W82°07.43'

ATLANTA

1046 NOTAM FILE AND

RWY 14-32: H2770X30 (ASPH) S-6.5 LIRL 0.4% up NW

RWY 14: Pole. Rgt tfc.

RWY 32: Pole.

SERVICE: LGT Actvt LIRL Rwy 14-32—CTAF.

AIRPORT REMARKS: Unattended. Twy markings are of wrong color. Rwy 14-32 is very bumpy with excessive patches along entire sfc length. Rwy 14-32 mult asph patches and uneven sfc.. Caution should be used to land at this airfield.

AIRPORT MANAGER: 864-684-8610

COMMUNICATIONS: CTAF 122.9

CLEARANCE DELIVERY PHONE: For CD ctc Greer Apch at 864-877-8275. When Greer Apch clsd, for CD ctc Atlanta ARTCC at 770-210-7692.