

MERRILL FLD (MRI)(PAMR) 2 E UTC-9(-8DT) N61°12.81' W149°50.68'

ANCHORAGE

143 B TPA—See Remarks LRA NOTAM FILE MRI

H-1B, 2K, L-1A, 3D, 4G

RWY 07-25: H4000X100 (ASPH) S-50, D-80 MIRL 0.3% up E

IAP, AD

RWY 07: REIL. VASI(V2L)—GA 3.75° TCH 43'. Pole. Rgt tfc.

RWY 25: REIL. VASI(V2L)—GA 3.0° TCH 21'. Bldg.

RWY 16-34: H2640X75 (ASPH) S-20 MIRL 0.3% up N

RWY 16: REIL. VASI(V2R)—GA 3.0° TCH 22'. Bldg. Rgt tfc.

RWY 34: REIL. PAPI(P2L)—GA 3.0° TCH 21'. Bldg.

RWY 05-23: H2000X60 (ASPH-GRVL)


RWY 05: Tree.

RWY 23: Road.

SERVICE: S4 FUEL 100, JET A OX 2, 4 LGT ACTVT REIL Rwy 07, 16, 25, 34; MIRL Rwy 07-25 and 16-34—CTAF. PAPI Rwy 34; VASI Rwy 07, 16 and 25 opr consly. All rwy and twy lgts nonstd height.

NOISE: Noise abatement; TGL or pat work NA 0700-1600Z†.

AIRPORT REMARKS: Special Air Traffic Rules—Part 93, see Regulatory Notices. Attended Mon-Fri 1630-0230Z†. Rwy 05-23 first 60 ft paved; rmng grvl. Rwy 05-23 used seasonally as snow rwy. Rcmd ski equip acft use to minimize wheel rutting. Helipad locid 20K. 1-8 ft snow berms adj to rwys and twys durg winter. Birds and seagulls on and infov arpt. Nonmovement area ctc gnd ctl bfr taxi. Ptns of Twy C btn Twy S and Twy N, and ptns of Twy Q not vis fm twr. Twy B south of Twy M, Twy G btn Twy N and Rwy 05-23, Twy Q east of Twy C and all sfcs south of Rwy 05-23 unctld. PPR ovr 12500 lb. TPA for acft 105 kts or less 900 ft MSL. Acft greater than 105 kts 1200 ft MSL. Compass rose avbl with prior cdn—ATCT. Arr/Dep Routes—See Area Notices; Spl Notice Cartee Asp. Alaska Rgnl Hospital 20K heli on arpt; See separate listing for info.

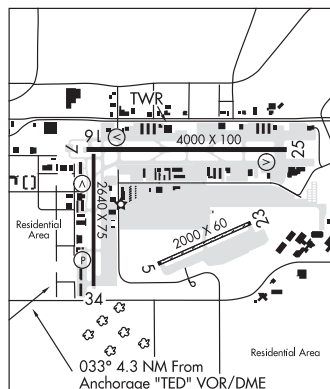

AIRPORT MANAGER: 907-343-6301

WEATHER DATA SOURCES: ASOS 124.25 (907) 271-5277. (WX CAM)

COMMUNICATIONS: CTAF 126.0 UNICOM 122.95 ATIS 124.25

RCO 122.2 (KENAI RADIO)

RCO 122.55 122.3 (KENAI RADIO)

Ⓡ **ANCHORAGE APP/DEP CON** 363.2 119.1

TOWER 126.0 127.55 (1600-0700Z†) GND CON 121.7

AIRSPACE: CLASS D svc 1600-0700Z†; other times CLASS E.

VOR TEST FACILITY (VOT) 111.0

RADIO AIDS TO NAVIGATION: NOTAM FILE ANC.

ANCHORAGE (H) (H) VORV/DME 113.15 TED Chan 78(Y) N61°10.07' W149°57.61' 033° 4.3 NM to fld. 92/18E.

VOR unusable:

041°-091° byd 25 NM blo 15,000'

091°-096° byd 20 NM blo 15,000'

096°-121° byd 25 NM blo 12,500'

121°-146° byd 25 NM blo 9,000'

DME unusable:

041°-091° byd 25 NM blo 15,000'

091°-096° byd 20 NM blo 15,000'

096°-121° byd 25 NM blo 12,500'

121°-146° byd 25 NM blo 9,000'

196°-206° byd 25 NM blo 3,500'

206°-211° byd 25 NM blo 4,000'

211°-221° byd 25 NM blo 3,500'

COMM/NAV/WEATHER REMARKS: For a toll free call to Kenai FSS dial 1-866-864-1737. FM radio interference may be received on twr freqs in tfc patterns. When ATCT clsd ctc Merrill wx—CTAF or 271-4355. When twr clsd CTAF procedures are recommended. See Regulatory Notices Anchorage Terminal Area Merrill Segment this supplement. Flt planning in Anchorage Bowl Area (RCO) 122.55.