

INDEPENDENCE (207) 1 N UTC-8(-7DT) N36°48.98' W118°12.30'

SAN FRANCISCO

3908 TPA—4708(800) NOTAM FILE RAL

L-9A

RWY 14-32: H3533X60 (ASPH) S-20 MIRL

RWY 14: Fence.

RWY 32: Trees. Rgt tfc.

RWY 05-23: 1498X30 (DIRT) 1.9% up SW

RWY 05: Road.

RWY 23: Fence.

SERVICE: LGT ACTIVATE MIRL Rwy 14-32—CTAF.

AIRPORT REMARKS: Unattended. Rwy 05-23 clsd for public use. Rwy 05-23 unsafe for acft. Rwy 05-23 rstd can be used only during extreme crosswind conditions. Tfc pat indicators for Rwy 14-32 only. Rwy 14-32 extsv cracks on the north end of the rwy. Rwy 05-23 marked with an R on each end, no numbers or centerline markings. Rwy 05-23 undulating uneven dirt sfc. Brush in sporadic locations on rwy. Rwy 05-23 sfc uneven, rough, undulating with extsv brush. Unsafe for acft use.

AIRPORT MANAGER: 760-872-2971

COMMUNICATIONS: CTAF 122.9

CLEARANCE DELIVERY PHONE: For CD ctc Joshua Apch at 661-277-3843.

RADIO AIDS TO NAVIGATION: NOTAM FILE BIH.

BISHOP (L) (L) VOR/DME 113.35 BIH Chan 80(Y) N37°22.62' W118°21.99' 152° 34.5 NM to fld. 4117/15E.

VOR unusable:

165°-285° byd 12 NM

305°-315° byd 35 NM

340°-135° byd 12 NM

DME unusable:

165°-285° byd 12 NM

305°-315° byd 35 NM

340°-135° byd 12 NM

INYOKERN (IYK)(KIYK) 1 NW UTC-8(-7DT) N35°39.52' W117°49.77'

LOS ANGELES

2457 B NOTAM FILE IYK

H-41, L-7C

RWY 15-33: H7100X75 (ASPH) S-24 PCN 7 F/C/Y/U MIRL

0.4% up NW

RWY 15: PAPI(P2L)—GA 3.0° TCH 40'.

RWY 33: PAPI(P2L)—GA 3.3° TCH 40'.

RWY 02-20: H6275X75 (ASPH) S-30, D-50, 2D-80 PCN 6 F/C/X/U

MIRL 0.4% up S

RWY 02: PAPI(P2L)—GA 3.3° TCH 40'.

RWY 20: VASI(V4L)—GA 3.0° TCH 35'. Thld dsplcd 320'. Rgt tfc.

RWY 10-28: H4150X75 (ASPH) S-24 PCN 7 F/C/Y/U MIRL

1.0% up W

RWY 28: Thld dsplcd 103'.

SERVICE: S2 FUEL 100LL, JET A LGT ACTVT VASI Rwy 20; MIRL Rwy 02-20, Rwy 10-28, Rwy 15-33—CTAF. PAPI Rwy 02, Rwy 15 and Rwy 33 opr consly.

AIRPORT REMARKS: Attended Mon-Fri 1500-0100Z†, Frequent glider ops on weekends. After 0000Z† callout fee for svc call 760-382-3383. Rwy 10-28 condition poor but stable. Ptns of rwy ctrln marking obscd by crack filler. Rwy 15-33 surface: pavement experiencing longl and lateral block cracking on ptns of rwy.

AIRPORT MANAGER: 760-377-5844

COMMUNICATIONS: CTAF/AUNICOM 122.8

JOSHUA APP/DEP CON 133.65

CLEARANCE DELIVERY PHONE: For CD ctc Los Angeles ARTCC at 661-575-2079.

RADIO AIDS TO NAVIGATION: NOTAM FILE EDW.

EDWARDS (T) (T) VORTACW 116.4 EDW Chan 111 N34°58.94' W117°43.96' 341° 40.8 NM to fld. 2378/12E.

TACAN AZIMUTH unusable:

098°-158° byd 19 NM blo 7,900'


DME unusable:

107°-158° byd 19 NM

VOR unusable:

098°-158° byd 19 NM blo 7,900'

COMM/NAV/WEATHER REMARKS: Automated UNICOM-3 clicks for arpt advisory and wx or dial 617-262-3825, 4 clicks for radio check. Monitor 122.8 in tfc pat.

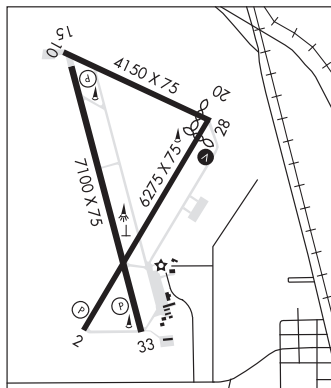

JACK MC NAMARA FLD (See CRESCENT CITY on page 144)

JACK NORTHROP FLD/HAWTHORNE MUNI (See HAWTHORNE on page 173)