

HILLTOP (See CHUGIAK on page 81)

HOLLIS

CLARK BAY SPB (HYL) 1 NE UTC-9(-8DT) N55°29.43' W132°37.41'

KETCHIKAN

00 NOTAM FILE KTN

WATERWAY E-W: 10000X500 (WATER)

SEAPLANE REMARKS: Unattended. Opr area in Clark Bay.

AIRPORT MANAGER: 907-755-2229

COMMUNICATIONS: CTAF 122.9

RADIO AIDS TO NAVIGATION: NOTAM FILE ANN.

ANNETTE ISLAND (H) (H) VOR/DME 117.1 ANN Chan 118

N55°03.62' W131°34.70' 285° 44.2 NM to fld. 184/21E.

VOR unusable:

000°-100° byd 11 NM blo 12,000'

000°-100° byd 15 NM

000°-100° byd 9 NM blo 6,500'

120°-130° byd 37 NM blo 6,000'

290°-320° byd 32 NM blo 7,000'

290°-320° byd 37 NM blo 9,000'

345°-000° byd 20 NM

DME unusable:

000°-100° byd 11 NM blo 12,000'

000°-100° byd 15 NM

000°-100° byd 9 NM blo 6,500'


120°-130° byd 37 NM blo 6,000'

290°-320° byd 32 NM blo 7,000'

290°-320° byd 37 NM blo 9,000'

345°-000° byd 20 NM

COMM/NAV/WEATHER REMARKS: For a toll free call to Ketchikan FSS dial 800-478-3500. For a LC to Juneau FSS dial 789-7380.

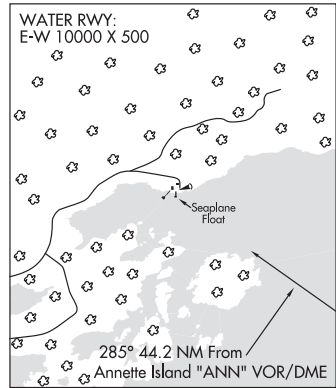

HOLY CROSS (HCA)(PAHC) 1 S UTC-9(-8DT) N62°11.30' W159°46.50'

MC GRATH

75 B NOTAM FILE HCA

H-1B, 2I, L-3C

RWY 02-20: 4000X100 (GRVL) MIRL

IAP

RWY 02: Trees.

RWY 20: Trees.

SERVICE: S4 LGT ACTVT MIRL Rwy 02-20—CTAF.

AIRPORT REMARKS: Unattended. Moose on and invof arpt. Cold

temperature airport. Altitude correction required at or below -28C.

Rwy condition not monitored; recommend visual inspection prior to

landing. Rwy 02-20 shallow ponding at twy after rain.

AIRPORT MANAGER: 907-438-2416

WEATHER DATA SOURCES: AWOS-3P 118.325 (907) 476-7231. (WX CAM)

COMMUNICATIONS: CTAF 122.8

ANIAK RCO 122.45 (KENAI RADIO)

® **ANCHORAGE CENTER APP/DEP CON** 118.15

RADIO AIDS TO NAVIGATION: NOTAM FILE ANV.

ANVIK NDB (HW) 365 ANV N62°38.49'

W160°11.12' 142° 29.6 NM to fld. 318/15E.

COMM/NAV/WEATHER REMARKS: For a toll free call to Kenai FSS dial 1-866-864-1737.

