

TOKEEN SPB (57A) 0 W UTC-9(-8DT) N55°56.23' W133°19.60'

KETCHIKAN

00 NOTAM FILE KTN

WATERWAY NE-SW: 6000X400 (WATER)

SEAPLANE REMARKS: Unattended. Boats active in harbor vicinity, no seaplane float. Float pilings may damage seaplane wings. Kelp bed southeast of boat float.

AIRPORT MANAGER: 907-247-1201

COMMUNICATIONS: CTAF 122.9

RADIO AIDS TO NAVIGATION: NOTAM FILE SIT.

LEVEL ISLAND (H) (H) VORW/DME 116.5 LVD Chan 112 N56°28.06' W133°04.99' 174° 32.9 NM to fld. 98/20E.

VOR unusable:

020°-050° byd 37 NM

270°-300° byd 25 NM blo 10,000'

301°-321° byd 25 NM blo 7,000'

wx cam avbl at <https://weathercams.faa.gov>

DME unusable:

020°-050° byd 25 NM blo 11,000'

020°-050° byd 37 NM

105°-120° byd 29 NM blo 10,000'


121°-135° byd 35 NM blo 7,000'

270°-300° byd 25 NM blo 10,000'

301°-321° byd 25 NM blo 7,000'

345°-350° byd 36 NM blo 8,000'

COMM/NAV/WEATHER REMARKS: For a LC to Ketchikan FSS dial 255-9481. For a LC to Juneau FSS dial 789-7380.

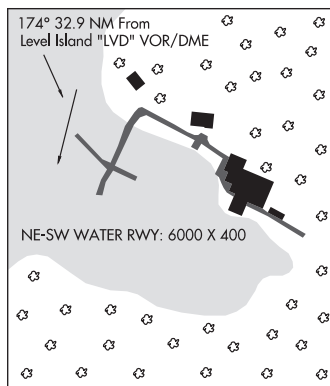

TOKSOOK BAY (OOK)(PA00) 1 NE UTC-9(-8DT) N60°32.48' W165°05.23'

BETHEL

71 B NOTAM FILE OOK

L-3B

RWY 16-34: 3200X75 (GRVL-DIRT) MIRL 0.7% up N

IAP

RWY 16: REIL. PAPI(P4L)—GA 4.0° TCH 37'.

RWY 34: REIL. PAPI(P4R)—GA 3.0° TCH 30'.

SERVICE: LGT ACTVT REIL Rwy 16 and Rwy 34; PAPI Rwy 16 and Rwy 34; MIRL Rwy 16-34, and rotating bcn—CTAF. Rwy 16 PAPI unusbl byd 9 deg left of cntrln.

AIRPORT REMARKS: Unattended. Rwy cond unmtnt; rcmdnd visual inspr prior to use. Birds on and invof arpt. Vehicle and ATV tfc on rwy and ramp. Exp random turbulent winds.

AIRPORT MANAGER: (907) 543-2498

WEATHER DATA SOURCES: AWOS-3P 119.275 (907) 427-7004. (WX CAM)

COMMUNICATIONS: CTAF 122.9

KIPNUK RCO 122.6 (KENAI RADIO)

® **ANCHORAGE CENTER APP/DEP CON** 125.2

RADIO AIDS TO NAVIGATION: NOTAM FILE BET.

BETHEL (H) (H) VORTACW 114.1 BET Chan 88 N60°47.09'

W161°49.46' 249° 97.4 NM to fld. 105/14E.

COMM/NAV/WEATHER REMARKS: For a toll free call to Kenai FSS dial 1-866-864-1737.

