

## LANCASTER

**KIRK AIR BASE** (T73) 5 SE UTC-5(-4DT) N34°40.46' W80°40.94'

CHARLOTTE

578 NOTAM FILE AND

**RWY 15-33:** H2600X40 (ASPH) S-8 LIRL**RWY 33:** Tree.**SERVICE:** S4 **FUEL** 100LL **LGT** For LIRL Rwy 15-33 call 803-286-8800.**AIRPORT REMARKS:** Attended 1300-2330Z. Rwy 15 has 30' drop at thld. Rwy 33 has 10' drop at thld.**AIRPORT MANAGER:** 803-286-8800**COMMUNICATIONS:** CTAF 122.9**CLEARANCE DELIVERY PHONE:** For CD ctc Charlotte Apch at 704-359-0241.

. . . . .

**WATERWAY 05W-23W:** 4400X300 (WATER)**WATERWAY 16W-34W:** 3000X300 (WATER)**WATERWAY 11W-29W:** 2245X600 (WATER)**SEAPLANE REMARKS:** Waterways 05-23, 11-29 and 16-34 water lanes are not marked, lengths change with water levels ctc aprt mgr and check NOTAM's.**LANCASTER CO-MC WHIRTER FLD** (LKR)(KLLR) 4 W UTC-5(-4DT) N34°43.37'

CHARLOTTE

W80°51.28'

H-9B, 12G, L-24J, 25D, 36E

486 B NOTAM FILE AND

IAP

**RWY 06-24:** H6004X101 (CONC) S-44, D-60, 2D-118

PCN 15 R/B/X/T MIRL 0.4% up NE

**RWY 06:** REIL. PAPI(P2L)—GA 3.0° TCH 41'. Thld dsplcd 105'. Tree.**RWY 24:** REIL. PAPI(P2L)—GA 3.15° TCH 39'. Tree.**SERVICE:** **FUEL** 100LL, **JET A** **LGT** ACTVT REIL Rwy 06 & 24; MIRL Rwy 06-24—CTAF. PAPI Rwy 06 and Rwy 24 opr consly.**AIRPORT REMARKS:** Attended 1230-2000Z. Deer on and infov aprt. For fuel after hrs call 803-285-1513. 25' drop, 250' fm thr Rwy 06. Small acft must be on a tie down. Arl applicators not pmtd due to pavement conds. Lndg fee.**AIRPORT MANAGER:** (803) 285-1513**WEATHER DATA SOURCES:** AWOS-3 120.825 (803) 286-6444.**COMMUNICATIONS:** CTAF/UNICOM 122.725® **CHARLOTTE APP/DEP CON** 120.05**GCO** 121.725 (CHARLOTTE APCH)**CLEARANCE DELIVERY PHONE:** For CD ctc Charlotte Apch at 704-359-0241.**RADIO AIDS TO NAVIGATION:** NOTAM FILE CLT.**CHARLOTTE (L) (L) VORW/DME** 115.0 CLT Chan 97 N35°11.42'

W80°57.11' 175° 28.4 NM to fld. 732/5W.

DME portion unusable:

015°-050° byd 25 NM blo 3,000'

050°-100° byd 25 NM blo 2,500'

185°-202° byd 15 NM


203°-220°

270°-350° byd 20 NM blo 5,000'

VOR/DME controlled by Charlotte ATCT

VOR unusable:

203°-220°

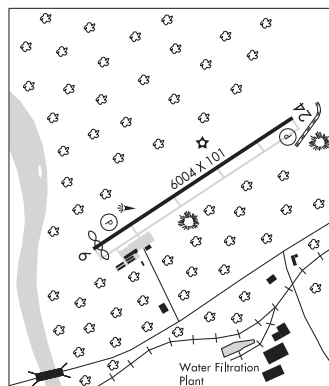

## LANDRUM

**FAIRVIEW** (33A) 3 SE UTC-5(-4DT) N35°09.44' W82°07.43'

ATLANTA

1046 NOTAM FILE AND

**RWY 14-32:** H2770X30 (ASPH) S-6.5 LIRL 0.4% up NW**RWY 14:** Pole. Rgt t/c.**RWY 32:** Pole.**SERVICE:** **LGT** Actvt LIRL Rwy 14-32—CTAF.**AIRPORT REMARKS:** Unattended. Twy markings are of wrong color. Rwy 14-32 is very bumpy with excessive patches along entire sfc length. Rwy 14-32 mult asph patches and uneven sfc.. Caution should be used to land at this airfield.**AIRPORT MANAGER:** 864-684-8610**COMMUNICATIONS:** CTAF 122.9**CLEARANCE DELIVERY PHONE:** For CD ctc Greer Apch at 864-877-8275. When Greer Apch clsd, for CD ctc Atlanta ARTCC at 770-210-7692.