

**NEW COALINGA MUNI** (C80) 3 E UTC-8(-7DT) N36°09.73' W120°17.69'

SAN FRANCISCO

625 B NOTAM FILE RIU

H-4H, L-3C

**RWY 12-30:** H5000X100 (ASPH) S-30 MIRL 0.5% up NW

IAP

**RWY 12:** REIL. PAPI(P2L)—GA 3.0° TCH 40'.

**RWY 30:** REIL. PAPI(P2L)—GA 3.0° TCH 40'. Rgt tfc.

**RWY 01-19:** H2471X60 (ASPH-GRVL) S-12.5

**RWY 19:** Rgt tfc.

**SERVICE:** LGT REIL Rwsy 12 and 30; MIRL Rwy 12-30; Perimeter lgts H1 on dusk—0800Z; after 0800Z; actvt—CTAF. PAPI Rwsy 12 and 30 opr consly. Rwy 30 VGSi OTS.

**AIRPORT REMARKS:** Attended irregularly. Rwy 01-19 clsd. Rwy 01-19 rwy sfc failed with potholes and brush.

**AIRPORT MANAGER:** 559-246-6243

**WEATHER DATA SOURCES:** AWOS-3 119.275 (559) 935-5960.

**COMMUNICATIONS:** CTAF/UNICOM 122.7

® **OAKLAND CENTER APP/DEP CON** 128.7

**CLEARANCE DELIVERY PHONE:** For CD ctc Oakland ARTCC at 510-745-3380.

**RADIO AIDS TO NAVIGATION:** NOTAM FILE PRB.


**PASO ROBLES (L) (L) VORTACW** 114.3 PRB Chan 90 N35°40.35'

W120°37.63' 013° 33.5 NM to fld. 817/16E.

TACAN AZIMUTH & DME unusable:

120°-140° byd 27 NM blo 8,000'

**COMM/NAV/WEATHER REMARKS:** AWOS OTS.

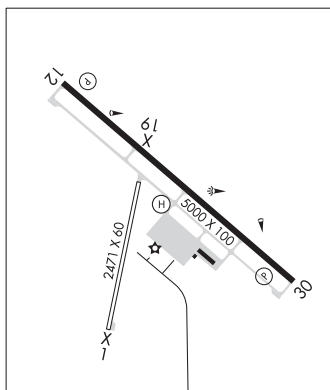

**HELIPAD H1:** H50X50 (ASPH) PERIMETER LGTS

**COLUMBIA** (022) 1 SW UTC-8(-7DT) N38°01.83' W120°24.87'

SAN FRANCISCO

2121 B TPA—See Remarks NOTAM FILE RIU

L-3B

**RWY 17-35:** H4673X75 (ASPH) S-30 MIRL 1.0% up N

IAP

**RWY 17:** REIL. VASI(V2L)—GA 4.55° TCH 56'. Thld dsplcd 598'.

Ground. Rgt tfc.

**RWY 35:** REIL. VASI(V2L)—GA 4.0° TCH 54'. Thld dsplcd 384'. Trees.

**RWY 11-29:** 2607X50 (TURF) 0.9% up W

**RWY 11:** Trees. Rgt tfc.

**RWY 29:** Trees.

**SERVICE:** S4 FUEL 100LL, JET A QX 2, 4 LGT Rwy 35 VASI unusable byd 5° left and 5° right of rwy centerline. ACTIVATE MIRL Rwy 17-35 and REIL Rwy 17 and Rwy 35—CTAF. VASI Rwy 17 and Rwy 35 opr continuously.

**AIRPORT REMARKS:** Attended 1600-0100Z. CAUTION: Rwy 11 departures prohibited due to conflict with main rwy. Varying wind direction and velocity may be encountered at mid point of Rwy 17-35 due to terrain features and wind flow patterns. Rwy 29 not recommended for use during winter months Nov through Mar. Turf twy north side of Rwy 11-29 not recommended for use Nov-Mar. All jet acft are requested to land Rwy 35 and depart Rwy 17 wind and weather permitting. Arpt has two rotating beacons, one on the arpt and one 6500' SE threshold Rwy 35. Calfire Air Tanker ops from arpt during fire season. Ldg fee for all commercial operators regardless of size and corporate acft over 12,500 pounds gross ldg weight. Avoid flights over Columbia State Park NE of arpt, and Highway 49 bridge 5 NM southwest of arpt and vicinity. Helicopter parking area 300' by 120' (4 positions). TPA Rwy 11-29 2921(800).

**AIRPORT MANAGER:** (209) 533-6684

**WEATHER DATA SOURCES:** AWOS-3 124.65 (209) 536-9384.

**COMMUNICATIONS:** CTAF/UNICOM 122.975

® **NORCAL APP/DEP CON** 125.1 (West-North)

® **OAKLAND CENTER APP/DEP CON** 121.25 (East-South)

**CLEARANCE DELIVERY PHONE:** For CD ctc NorCal Apch at 916-361-0516.

**RADIO AIDS TO NAVIGATION:** NOTAM FILE RIU.

**LINDEN (VH) (DH) VORW/DME** 114.8 LIN Chan 95 N38°04.47' W121°00.23' 078° 28.1 NM to fld. 266/17E.

DME unusable:

191°-235°

VOR unusable:

228°-232° byd 40 NM

236°-240° byd 40 NM

