

GIRDWOOD (AQY) 3 NE UTC-9(-8DT) N60°58.14' W149°07.16'

ANCHORAGE

164 NOTAM FILE ENA

RWY 02-20: 2095X60 (GRVL) 1.4% up N**RWY 02:** Brush.**RWY 20:** Brush.**AIRPORT REMARKS:** Unattended. Rwy cond unmnt, rcmd visual insp bfr lndg.

Daltg hang glider and parasail act 2 NM NE and on arpt. 100' cable fm hotel to roundhouse. Rwy 02-20 200' safety area both ends. Rwy

02-20 thr refelctors, edge mkr NA.

AIRPORT MANAGER: 907-783-2232**COMMUNICATIONS:** CTAF 122.9**RCO** 122.15 (KENAI RADIO)**RADIO AIDS TO NAVIGATION:** NOTAM FILE ANC.**ANCHORAGE (H) (H) VORW/DME** 113.15 TED Chan 78(Y)

N61°10.07' W149°57.61' 098° 27.3 NM to fld. 93/18E.

VOR unusable:

041°-091° byd 25 NM blo 15,000'

091°-096° byd 20 NM blo 15,000'

096°-121° byd 25 NM blo 12,500'

121°-146° byd 25 NM blo 9,000'

DME unusable:

041°-091° byd 25 NM blo 15,000'

091°-096° byd 20 NM blo 15,000'

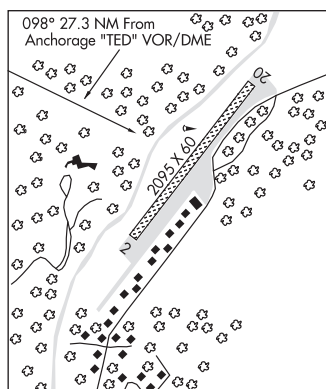
096°-121° byd 25 NM blo 12,500'

121°-146° byd 25 NM blo 9,000'

196°-206° byd 25 NM blo 3,500'

206°-211° byd 25 NM blo 4,000'

211°-221° byd 25 NM blo 3,500'

COMM/NAV/WEATHER REMARKS: For a toll free call to Kenai FSS dial 1-866-864-1737.**GLACIER CREEK** (KGZ) 0 N UTC-9(-8DT) N61°27.31' W142°22.86'

ANCHORAGE

2380 NOTAM FILE ENA

RWY 11-29: 1400X15 (GRVL)**RWY 11:** Trees.**RWY 29:** Tree.**AIRPORT REMARKS:** Unattended. Rwy condition not monitored.

Recommend visual inspection prior to ldg. Rwy 11-29 in steep mountain canyon and subject to turbulent winds. Rwy 11-29 sfc rough with rocks to 8" diameter ruts down rwy center, rwy undulates. Rwy 15' wide gvl path. Brush to 36" both sides. Rwy 11-29 not recommended for tri-cycle general acft.

AIRPORT MANAGER: 907-822-7240**COMMUNICATIONS:** CTAF 122.9**RADIO AIDS TO NAVIGATION:** NOTAM FILE ORT.**NORTHWAY (H) (H) VORTACW** 116.3 ORT Chan 110 N62°56.83'

W141°54.76' 172° 90.7 NM to fld. 1779/17E.

TACAN AZIMUTH unusable:

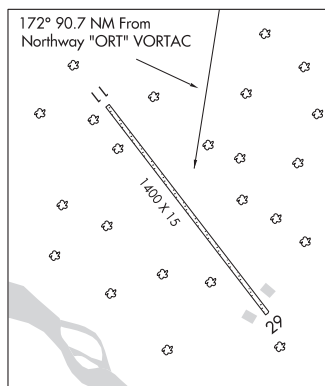
342°-037° byd 30 NM blo 10,500'

DME unusable:

342°-037° byd 30 NM blo 10,500'

COMM/NAV/WEATHER REMARKS: For a toll free call to Kenai FSS dial

1-866-864-1737.

**GLACIER RIVER** N60°29.93' W145°28.47' NOTAM FILE CDV.

ANCHORAGE

NDB (HW) 404 GCR at Merle K (Mudhole) Smith. 58/17E.

L-1A, 3E, 4H

GOLD KING CREEK (See FAIRBANKS on page 105)**GOLDEN HORN LODGE SPB** (3Z8) 1 NW UTC-9(-8DT) N59°44.82' W158°52.48'

KODIAK

91 NOTAM FILE DLG

WATERWAY NW-SE: 5000X1500 (WATER)**AIRPORT REMARKS:** Attended Jun-Oct.**AIRPORT MANAGER:** 907-842-8260**COMMUNICATIONS:** CTAF 122.9**RADIO AIDS TO NAVIGATION:** NOTAM FILE DLG.**DILLINGHAM (H) (H) VORW/DME** 116.4 DLG Chan 111 N58°59.65' W158°33.13' 333° 46.4 NM to fld. 81/15E.