BELUGA (BLG)(PABG) PVT UTC–9(–8DT) N61º10.38´ W151º02.72´ **ANCHORAGE**
87 NOTAM FILE Not insp. **H–1B, 2K, L–1A, 3D, 4F**

RWY 01–19: 5002X100 (GRVL) MIRL
RWY 01: Trees.
RWY 19: Trees.

RWY 09–27: 2505X60 (GRVL) MIRL 0.5% up W

SERVICE: **LGT** Rwy H1 Perimeter lgts.ACTIVATE MIRL Rwy 09–27 and Rwy 01–19—CTAF.

AIRPORT REMARKS: Attended continuously. Landing authorization apvl req prior to ops. Ctc supervisor 907–263–3930, mobile 907–263–3910. Additionally PPR for acft greater than 20,000 lbs. PPR is not required for small acft if ldg authorization is active. Rwy 09–27 not maintained in winter. West side of twy does not have shoulder beyond rwy edge lights. Shoulder area on west and north side of rwy soggy at times. Rwy 19 first 200´ soft and unstable. Wildlife on and invof airport. Entire rwy not visible by personnel on duty. Uncontrolled vehicles operating on service road along east side of rwy. Brush may hinder drivers from seeing approaching acft on AER 19. Located 8 SM NE of Tyonek. Road crosses adjacent to N end of Rwy 19. Conc helipad located NE of Rwy 19.

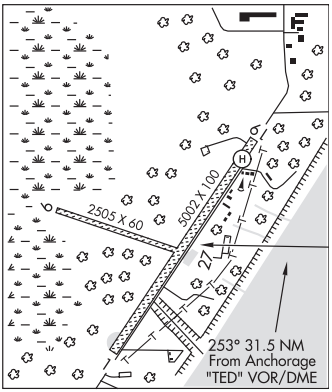

AIRPORT MANAGER: 907-777-8300

COMMUNICATIONS: CTAF/UNICOM 122.7

RADIO AIDS TO NAVIGATION: NOTAM FILE ANC.

ANCHORAGE (H) (H) VORW/DME 113.15 TED Chan 78(Y) N61º10.07´ W149º57.61´ 253º 31.5 NM to fld. 92/18E.

VOR unusable:
041º–091º byd 25 NM blo 15,000´
091º–096º byd 20 NM blo 15,000´
096º–121º byd 25 NM blo 12,500´
121º–146º byd 25 NM blo 9,000´

DME unusable:
041º–091º byd 25 NM blo 15,000´
091º–096º byd 20 NM blo 15,000´
096º–121º byd 25 NM blo 12,500´
121º–146º byd 25 NM blo 9,000´
196º–206º byd 25 NM blo 3,500´
206º–211º byd 25 NM blo 4,000´
211º–221º byd 25 NM blo 3,500´

COMM/NAV/WEATHER REMARKS: For a toll free call to Kenai FSS dial 1–866–864–1737.

• • • • • • • • • • • • • • • • • •

HELIPAD H1: H60X60 (CONC) PERIMETER LGTS