DANIELSON (LZD)(KLZD) 2 NW UTC–5(–4DT) N41°49.19´ W71°54.06´ **NEW YORK**
238 B NOTAM FILE BDR **L–33C, 34J**
RWY 13–31: H2700X75 (ASPH) S–29 MIRL **IAP**
RWY 13: Tree.
RWY 31: REIL. Tree.
SERVICE: S4 **FUEL** 100LL **LGT** ACTVT REIL Rwy 31; MIRL Rwy 13–31—CTAF.
AIRPORT REMARKS: Unattended. Parachute Jumping. Extsv paja SR–SS May–Oct. Gldr actvty on & invof arpt. Deer on & invof arpt. Self svc fuel, credit card rqrd: Visa, Mastercard. Ldg fee for business, corporate & revenue producing acft.
AIRPORT MANAGER: 860-982-2443
WEATHER DATA SOURCES: AWOS–3 119.125 (860) 779–7251.
COMMUNICATIONS: CTAF/UNICOM 123.0
Ⓡ **PROVIDENCE APP/DEP CON** 123.675 (Sun–Fri 1030–0530Z‡, Sat 1030–0500Z‡) other times ctc
BOSTON CENTER APP/DEP CON 124.85
CLEARANCE DELIVERY PHONE: For CD ctc Providence Apch at 401-738-8945, when Apch clsd ctc Boston ARTCC at 603-879-6859.
RADIO AIDS TO NAVIGATION: NOTAM FILE BDR.
PUTNAM (H) (H) VORW/DME 117.4 PUT Chan 121 N41°57.33´ W71°50.65´ 211° 8.5 NM to fld. 652/14W.
DME unusable:
265°–301° byd 36 NM blo 3,000´

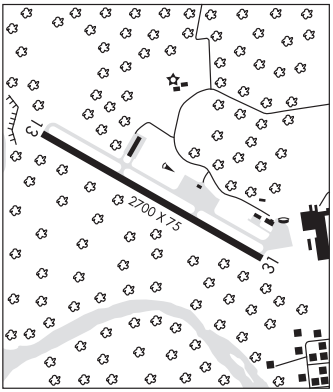

EAST HADDAM

GOODSPEED (42B) 1 SE UTC–5(–4DT) N41°26.74´ W72°27.34´ **NEW YORK**
9 NOTAM FILE BDR
RWY 14–32: H2120X50 (ASPH) S–8 LIRL
RWY 32: Trees.
SERVICE: S4 **LGT** Arpt lgts opr 24 hrs.
AIRPORT REMARKS: Unattended. Caution deer, birds and waterfowl on and invof arpt. Parl turf twy mkd with yellow cones. May be soft when wet or aft rain. Seaplane dock and ramp. Overnight parking fee. Ldg fee.
AIRPORT MANAGER: (860) 615-9068
COMMUNICATIONS: CTAF/UNICOM 122.8
CLEARANCE DELIVERY PHONE: For CD ctc New York Apch at 516-683-2449.

• • • • • • • • • • • • • • • • • • •

WATERWAY 16W–34W: 4500X1000 (WATER)
WATERWAY 16W: Bridge.
WATERWAY 34W: Hill.

ELLINGTON (7B9) 2 N UTC–5(–4DT) N41°55.53´ W72°27.43´ **NEW YORK**
253 NOTAM FILE BDR
RWY 01–19: H1800X50 (ASPH) S–9 RWY LGTS(NSTD)
RWY 01: Trees.
RWY 19: Trees.
SERVICE: S4 **FUEL** 100LL **LGT** Non–std LIRL opr dusk–0500Z‡, for lgts aft 0500Z‡ call 860–871–2054 durg bus hrs. Rwy 01–19 non–std LIRL due to spacing, thr lgts outboard of rwy.
AIRPORT REMARKS: Attended 1300–2300Z‡. Parachute Jumping. Extensive helicopter training ops. Acft tfc pat on E side of arpt only. Hel tfc pat on W side of arpt only. Twy pavement failed, extsv cracking, patches, loose aggregate and sml stones. Rwy 01 mkgs faded. Rwy 19 mkgs faded.
AIRPORT MANAGER: 860-614-1854
COMMUNICATIONS: CTAF/UNICOM 123.0
CLEARANCE DELIVERY PHONE: For CD ctc Yankee Apch at 860-386-3597.

FARMINGTON CT71 N41°42.54´ W72°48.13´/363 **NEW YORK**
AWOS–AV 129.825 AWOS–AV wx bcst on 129.825 (3 mic clicks). **L–33C, 34I**

GOODSPEED (See EAST HADDAM on page 35)