TACOMA, WASHINGTON

TACAN RWY 34

TACAN	APCH CRS	Rwy Idg	10,108
TCM Chan 33	347°	TDZE	322
		Arpt Elev	322

AL-414 [USAF]

MCCHORD FLD (KTCM)

▼ * When ALS inop, increase CAT AB RVR to 55, vis to 1 mile, CAT CD vis to 1½ miles.
** Circling not authorized E of Rwy 16-34.

ALSF-2

MISSED APPROACH: Climb to 4000 on TCM TACAN R-345 to OYABO, then turn left via 215° course to intercept TCM R-267 to CUBIT and hold. Cross OYABO at or above 3000. Continue climb-in-hold to 4000.

ATIS	SEATTLE APP CON	TOWER	GND CON
135.825 270.1	126.5 377.15	124.8 259.3	118.175 279.65

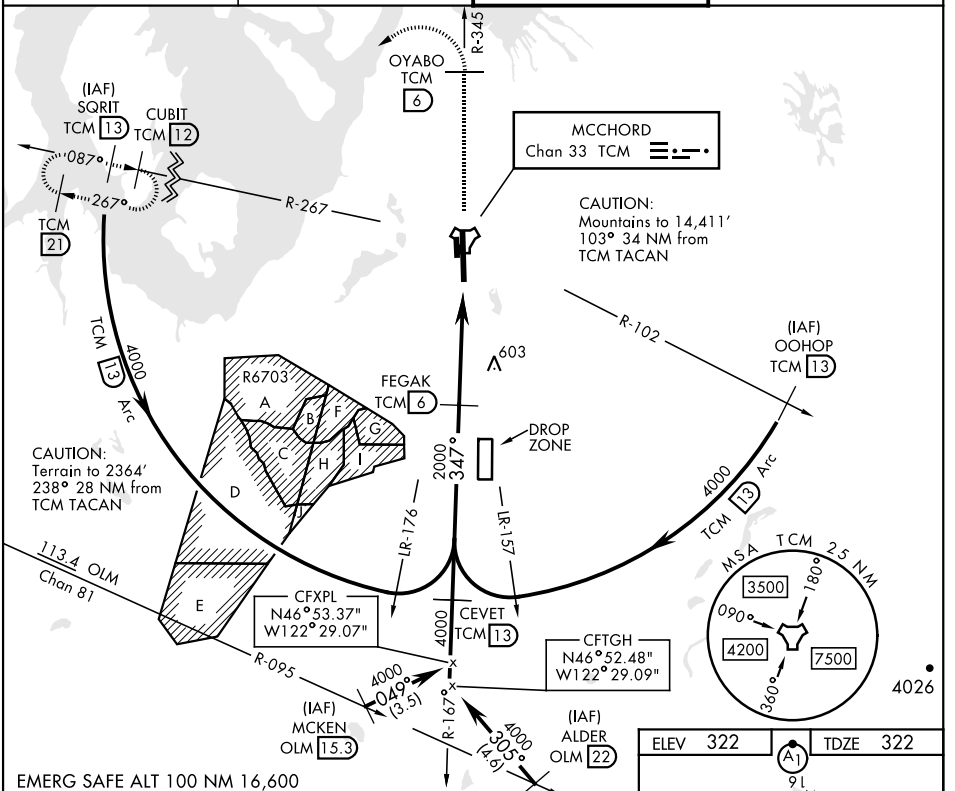

4000 TCM R-345	OYABO 6	crs 215°	TCM R-267

VGSI and descent angles not coincident
(VGSI Angle 3.00)

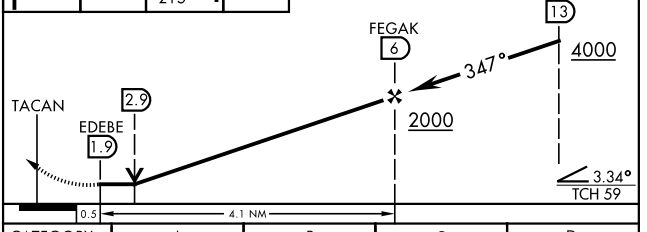

CATEGORY	A	B	C	D
S-34*	860/24 538 (600-½)		860/55 538 (600-1)	
C CIRCLING **	940-1 618 (700-1)		940-1¾ 618 (700-1¾)	940-2 618 (700-2)

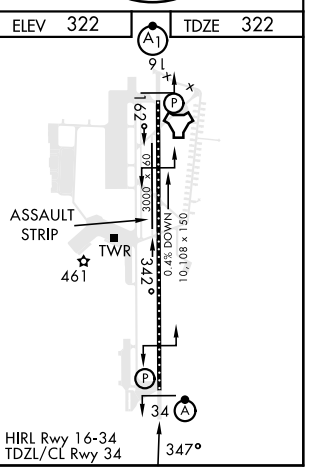

TACOMA, WASHINGTON

47°08'N-122°29'W

MCCHORD FLD (KTCM)

Amdt 5 20APR23

TACAN RWY 34

NW-1, 26 DEC 2024 to 23 JAN 2025