ILS RWY 11 (CAT II & III)
PORTLAND INTL JETPORT (PWM)

LOC/DME I-PWM	APP CRS	Rwy Ldg 7200
109.9	110°	TDZE 76
Chan 36		Apt Elev 76

Procedure NA when control tower closed.

ALSF-2

MISSED APPROACH: Climb to 600 then climbing right turn to 3000 direct ENE VOR/DME and hold.

ATIS	PORTLAND APP CON ★	PORTLAND TOWER ★	GND CON	UNICOM
119.05	119.75 269.35	120.9 L (CTAF) 257.8	121.9	122.95

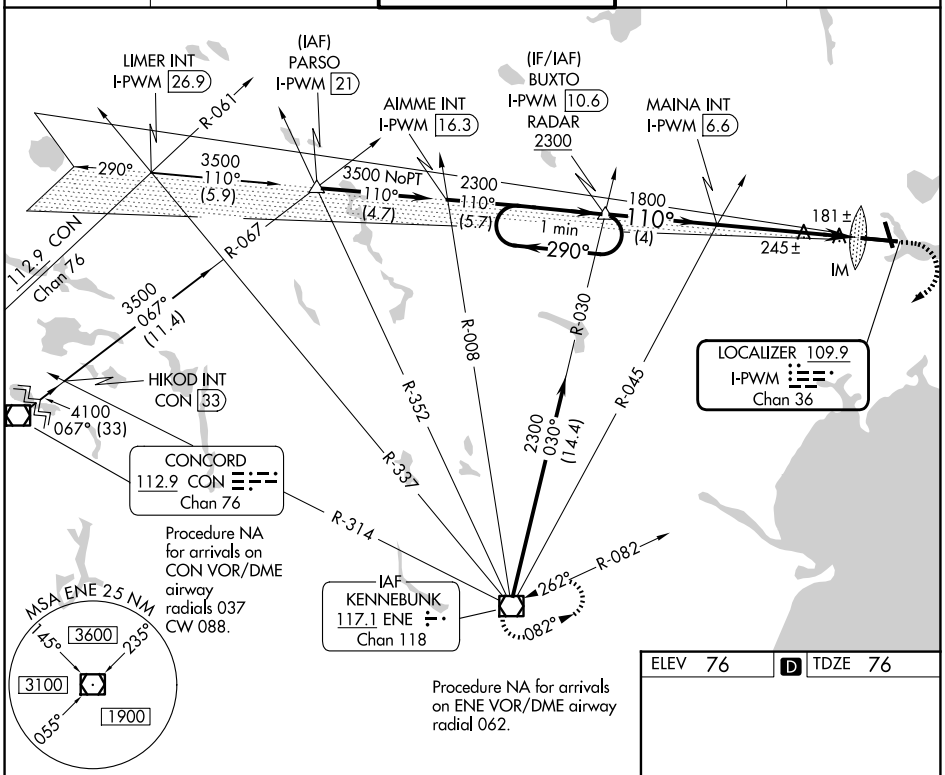

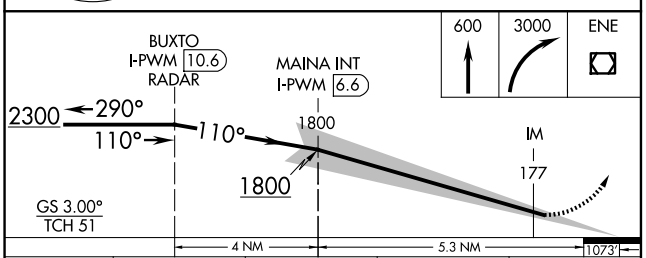

CATEGORY	A	B	C	D
S-ILS 11	CAT II RA 108/12 100 DA 176			
S-ILS 11	CAT III RVR 06			

CATEGORY II & III ILS-SPECIAL AIRCREW & AIRCRAFT CERTIFICATION REQUIRED

ELEV 76 | D | TDZE 76

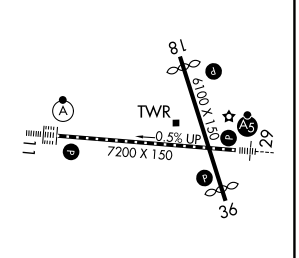

TDZL/RCLS Rwy 11 L
MIRL Rwy 18-36 L
HIRL Rwy 11-29 L
REIL Rwys 18 and 36 L

NE-1, 27 NOV 2025 to 25 DEC 2025

NE-1, 27 NOV 2025 to 25 DEC 2025