MAYPORT, FLORIDA

# TACAN Y RWY 5

| TACAN | APCH CRS | Rwy Idg | 8001 |
|---|---|---|---|
| Chan 51 | 055° | TDZE | 12 |
| NRB | | Arpt Elev | 15 |

[USN] MAYPORT NS (ADM DAVID L. MC DONALD FLD) (KNRB)

MISSED APPROACH: Climb to 500. Then climbing right turn to 3000 via NRB TACAN R-081 to BENGE and hold, continue climb in hold to 3000.

| ATIS ★ | JACKSONVILLE APP CON | TOWER ★ | GND CON | ASR/PAR |
|---|---|---|---|---|
| 236.775 | 124.9 308.4 | 118.75 239.3 (L) | 126.5 233.7 | |

CAUTION: Circling not authorized to Rwy 23 at night when VGSI inop on Rwy 23, unless the station has an approved observer watching for marine traffic in the St. John's River channel.

CAUTION: Intmed seg len 4 NM.

CRG feeder requires turn in hold.

Final approach course is 317° from rwy centerline at 3000' from threshold.

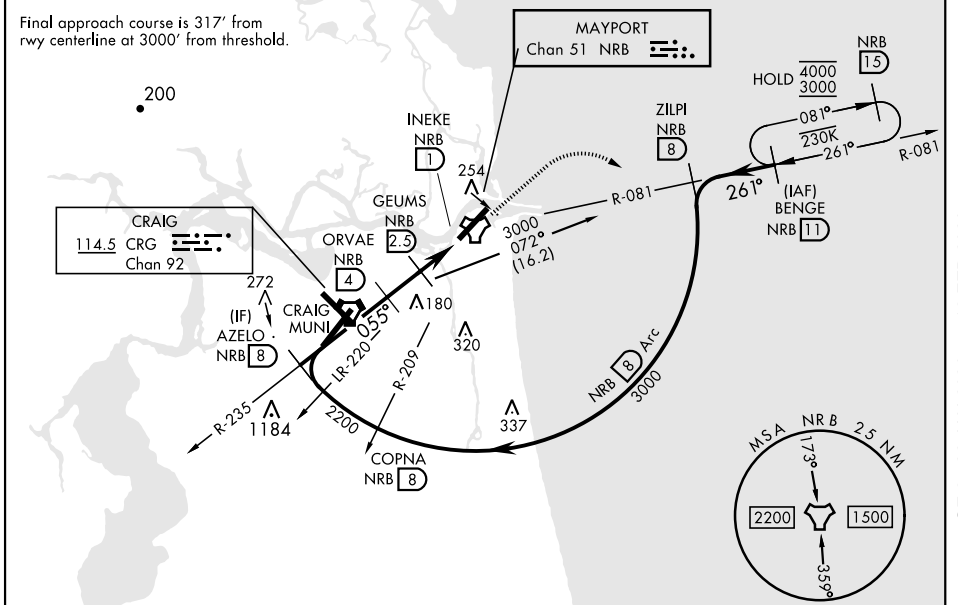


EMERG SAFE ALT 100 NM 2800

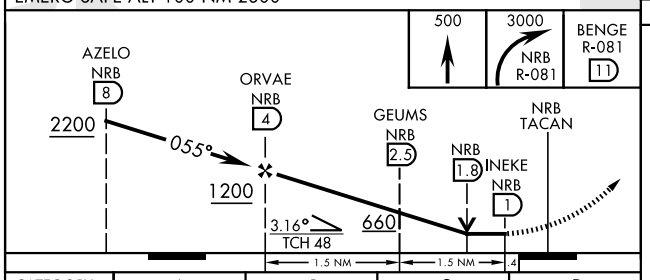


ELEV 15 TDZE 12

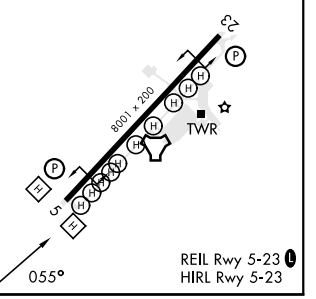


REIL Rwy 5-23 (L)
HIRL Rwy 5-23

| CATEGORY | A | B | C | D |
|---|---|---|---|---|
| S-5 | 440-1 428 (500-1) | | 440-1¼ 428 (500-1¼) | |
| (C) CIRCLING | 560-1 545 (600-1) | | 560-1½ 545 (600-1½) | 620-2 605 (700-2) |

MAYPORT, FLORIDA

30°23'N-81° 25'W MAYPORT NS (ADM DAVID L. MC DONALD FLD) (KNRB)

Amdt 5 05SEP24

TACAN Y RWY 5



SE-3, 22 JAN 2026 to 19 FEB 2026