

WAAS CH 50244 W31A	APP CRS 300°	Rwy Ldg 8500 TDZE 429 Apt Elev 476
--	------------------------	---


RNAV (GPS) Z RWY 31L
PALM SPRINGS INTL (PSP)


RNP APCH-GPS.


T
A Circling NA southwest of Rwy 13R-31L.

MISSED APPROACH: Climb to 900 then climbing right turn to 4000 direct TANFY and track 107° to BANPE and track 144° to TRM VORTAC and hold.
*Missed approach requires minimum climb of 355 feet per NM to 2100.

ATIS 124.65	SOCAL APP CON 126.7 370.95 135.275 251.1	PALM SPRINGS TOWER* 119.7 (CTAF) 0 377.05	GND CON 121.9	UNICOM 122.95
----------------	--	--	------------------	------------------

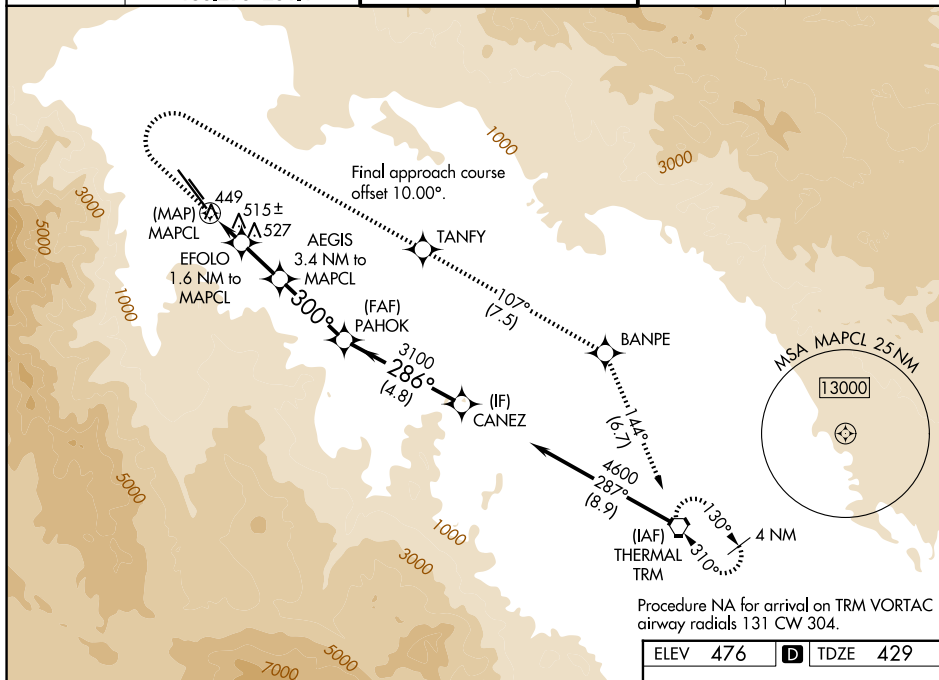

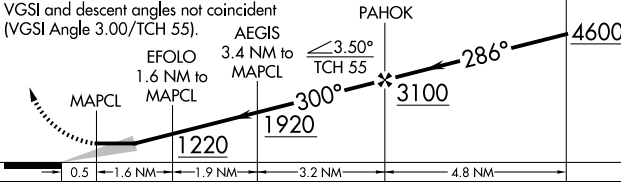900 ↑	4000 	TANFY 	tr 107° 	BANPE 	tr 144° 	TRM 	CANEZ
VGSJ and descent angles not coincident (VGSJ Angle 3.00/TCH 55).						PAHOK	
							
CATEGORY	A		B		C	D	
LP MDA	700-1 271 (300-1)		780-1 351 (400-1)		1320-2½	891 (900-2½)	
RNAV MDA*	780-1 351 (400-1)						
RNAV MDA	920-1 491 (500-1)		1180-1¼ 751 (800-1¼)		1440-3	1011 (1000-3)	
CIRCLING	920-1 444 (500-1)		1180-1¼ 704 (800-1¼)		1440-3 964 (1000-3)	1760-3 1284 (1300-3)	

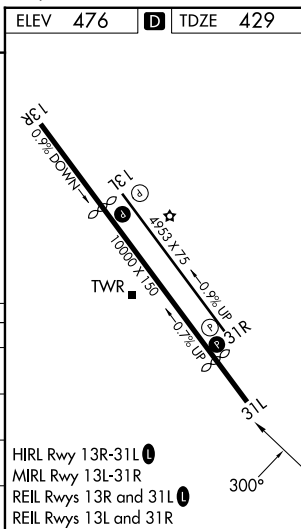

RNAV (GPS) Z RWY 31L