
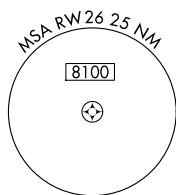
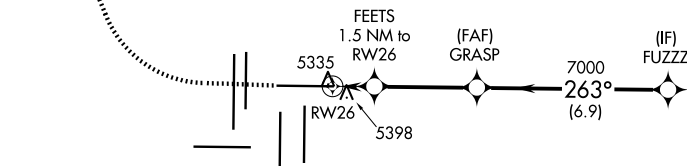




WAAS CH 58128 W26A	APP CRS 263°	Rwy Ldg 12000 TDZE 5309 Apt Elev 5434
--	------------------------	--

RNAV (GPS) Y RWY 26
DENVER INTL (DEN)

RNP APCH.			MISSED APPROACH: Climb to 6000 then climbing right turn to 11000 direct NIWOT and hold.
▼ For uncompensated Baro-VNAV systems, LNAV/VNAV NA below -25°C or above 46°C. Simultaneous approach authorized with Rwy 25. For inoperative ALS, increase LNAV/VNAV all Cats visibility to RVR 4000 and LNAV Cat C/D visibility to RVR 5500. LNAV procedure NA during simultaneous operations. Use of FD or AP providing RNAV track guidance required during simultaneous operations.			
D-ATIS 125.6 379.9	DENVER APP CON 119.3 307.3 (N) 120.35 379.3 (S)	DENVER TOWER 132.35 239.275	GND CON 121.35 379.175 (W) 121.85 377.1 (E)

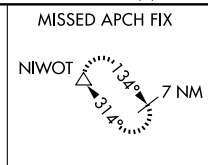

ELEV 5434	D	TDZE 5309
-----------	----------	-----------

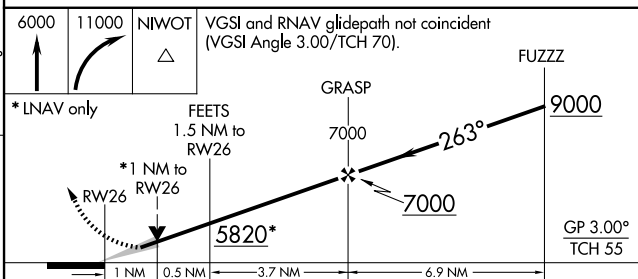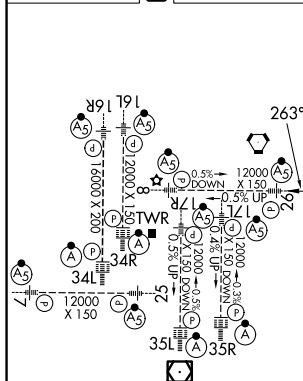

CATEGORY	A	B	C	D
LPV DA	5509/18 200 (100-½)			
LNAV/ VNAV DA	5559/24 250 (200-½)			
LNAV MDA	5660/24 351 (300-½)	5660/30 351 (300-¾)		