RNAV (RNP) Z RWY 5

BUFFALO NIAGARA INTL (BUF)


APP CRS		
055°	Rwy Ldg	7569
	TDZE	708
	Apt Elev	727


For uncompensated Baro-VNAV systems, procedure NA below -18°C (0°F) or above 54°C (130°F). GPS required. For inoperative MALSR, increase RNP 0.10 all Cats visibility to 1¼ . For inoperative MALSR, increase RNP 0.30 all Cats visibility to 1⅝.

MALSR

MISSED APPROACH: Climb to 3000 on the RNAV missed approach route to TRAVA and hold.


D-ATIS	BUFFALO APP CON	BUFFALO TOWER	GND CON
135.35	126.15 263.125	120.5 257.8	133.2 257.8

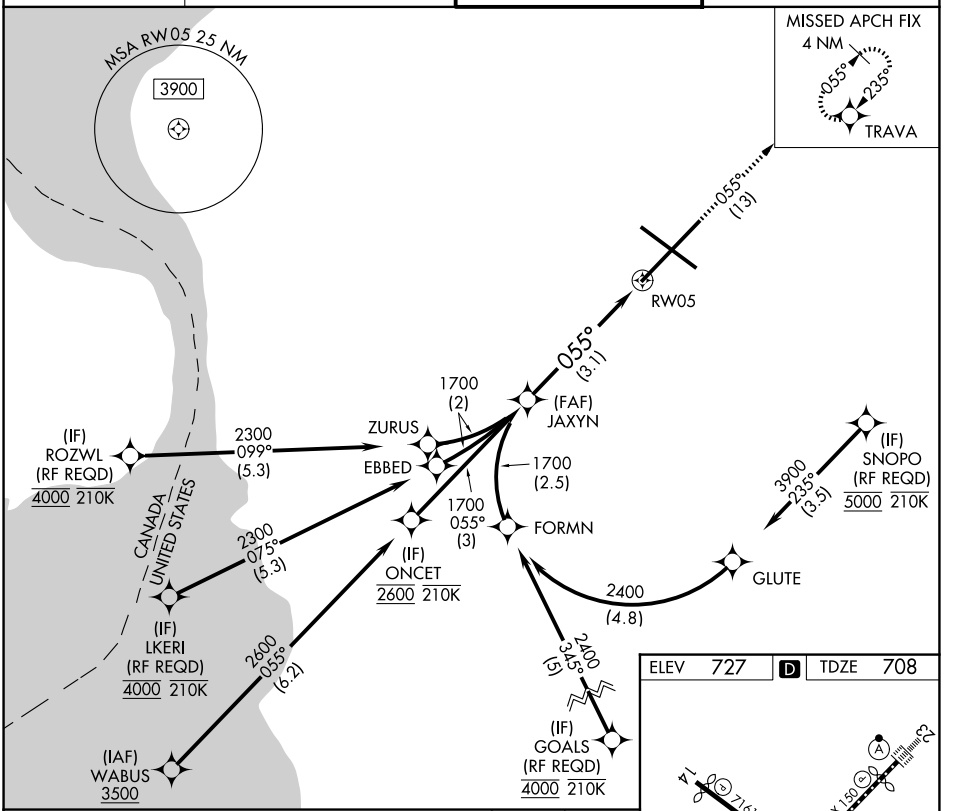

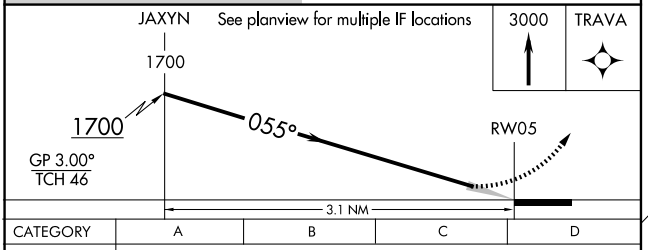

CATEGORY	A	B	C	D
RNP 0.10 DA	1065/45 357 (400-⅞)			
RNP 0.30 DA	1159/60 451 (500-1¼)			

AUTHORIZATION REQUIRED

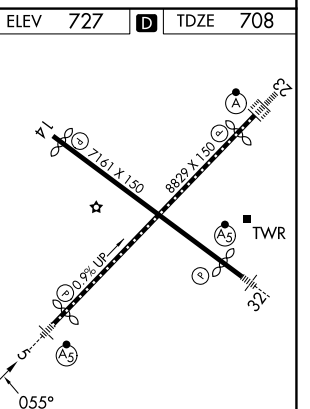

REIL Rwy 14
TDZL/RCLS Rwys 5 and 23
HIRL Rwys 5-23 and 14-32

NE-2, 01 OCT 2026 to 29 OCT 2026
NE-2, 01 OCT 2026 to 29 OCT 2026