


CO NDB 407	APP CRS 352°	Rwy Ldg 11022 TDZE 6075 Apt Elev 6187	NDB RWY 35L	
			CITY OF COLORADO SPRINGS MUNI (COS)	

▼ ▲ RADAR monitoring required when R-2601 in use. For inop ALS, increase S-35L Cat A/B visibility RVR 5500, and Cat C/D to 1½ SM.	MALSR	MISSED APPROACH: Climb to 6700 then climbing right turn to 9000 on heading 051° and on BRK VOR/DME R-091 to ADANE INT/BRK 11.1 DME and hold.
--	------------------------------	--

ATIS 125.0 254.3	SPRINGS APP CON 124.0 257.875	SPRINGS TOWER 119.9 360.6	GND CON 121.7 348.6	CLNC DEL 134.45 363.125
---------------------	----------------------------------	------------------------------	------------------------	----------------------------

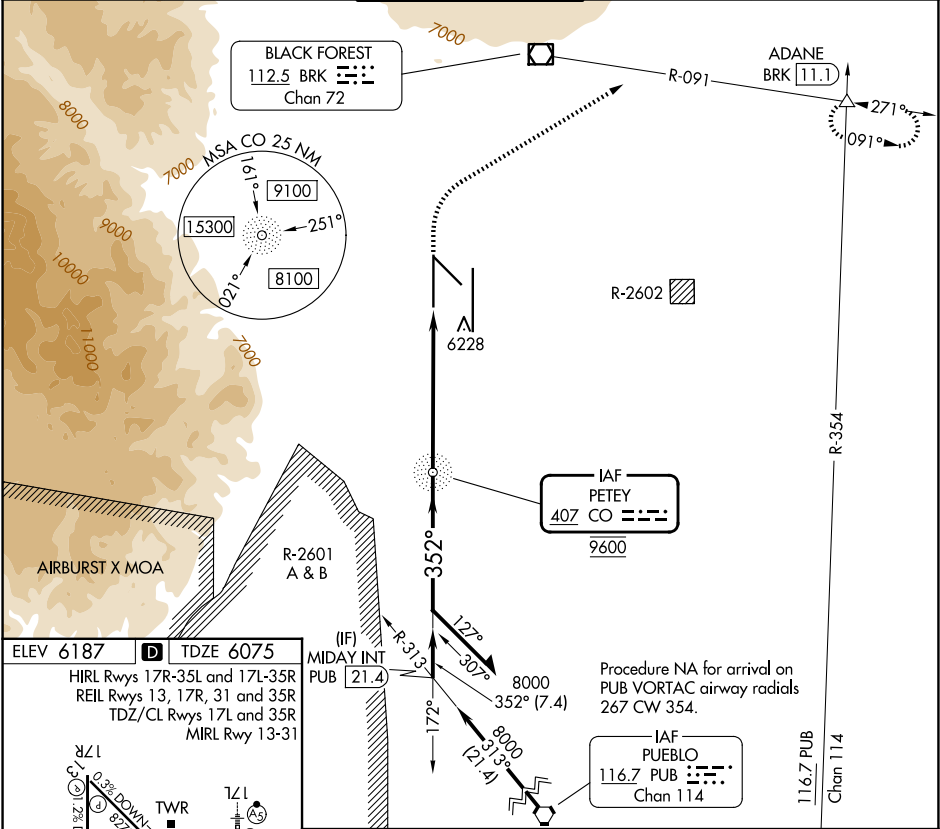

FAF to MAP 6 NM	
Knots	60 90 120 150 180
Min:Sec	6:00 4:00 3:00 2:24 2:00

Remain within 10 NM 8000 172° 352° 8000 3.00° TCH 55 6 NM		CO NDB 9600 6700 9000 hdg 051° BRK R-091 ADANE △ VGSI and descent angles not coincident (VGSI Angle 3.00/TCH 72).		
CATEGORY	A	B	C	D
S-35L	6540/40	465 (400-¾)	6540/50	465 (400-1)
CIRCLING	6740-1 553 (600-1)	6760-1 573 (600-1)	6980-2¼ 793 (800-2¼)	7240-3 1053 (1100-3)