


LOC/DME I-ONB 109.1 Chan 28	APP CRS 281°	Rwy Ldg 8000 TDZE 813 Apt Elev 815
---	------------------------	---

ILS or LOC RWY 28R
JOHN GLENN COLUMBUS INTL (CMH)

DME or RADAR required.		MALSR	MISSED APPROACH: Climb to 1400 then climbing right turn to 3000 direct APE VORTAC and hold.
Simultaneous approach authorized. Autopilot coupled approach NA. For inop ALS, increase S-LOC 28R Cat C/D visibility to 1½ SM.			
D-ATIS 124.6	COLUMBUS APP CON 125.95 371.975	COLUMBUS TOWER 132.7 257.8	GND CON 121.9 348.6

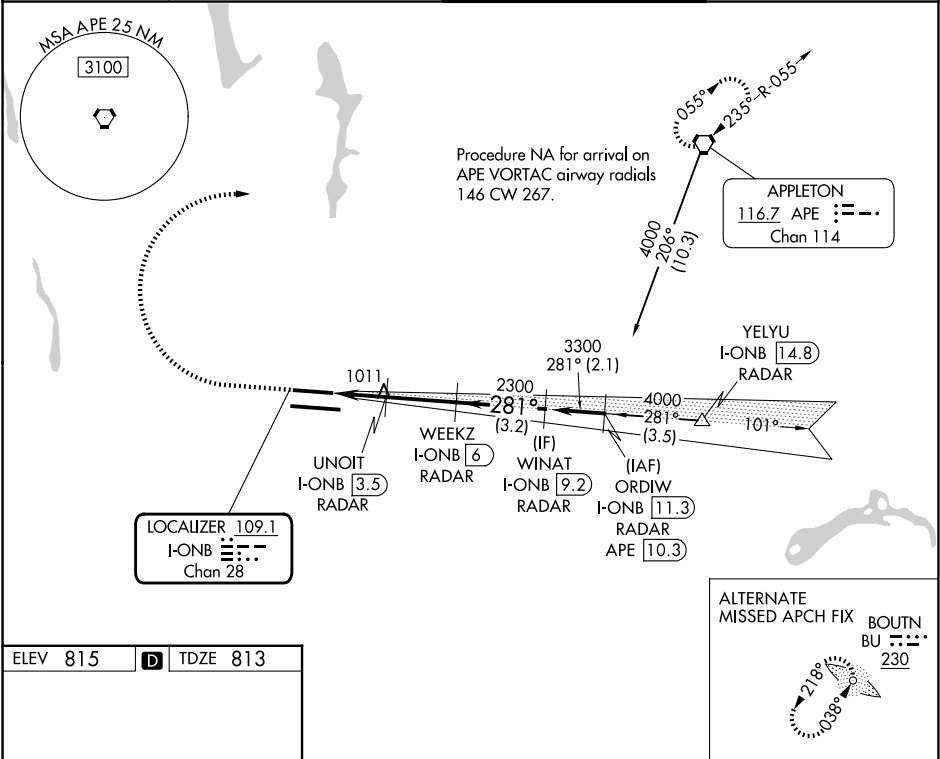

ELEV 815	D	TDZE 813
TDZL/RCLS Rwy 10R-28L HIRL Rwys 10R-28L and 10L-28R FAF to MAP 4.5 NM		
Knots	60	90 120 150 180
Min:Sec	4:30 3:00	2:15 1:48 1:30

CATEGORY	A	B	C D
S-ILS 28R	1013/24 200 (200-½)		
S-LOC 28R	1280/24	467 (500-½)	1280/50 467 (500-1)
CIRCLING	1340-1	525 (600-1)	1520-2 705 (800-2) 1520-2¼ 705 (800-2¼)

EC-2, 01 OCT 2026 to 29 OCT 2026

EC-2, 01 OCT 2026 to 29 OCT 2026