



LOC/DME I-VUQ	APP CRS	Rwy Ldg
111.9	241°	10900
Chan 56		TDZE 997
		Apt Elev 1009


ILS or LOC RWY 24R

JAMES M COX DAYTON INTL (DAY)

ADF required for alternate missed approach.	MALSR	MISSED APPROACH: Climb to 3000 then right turn direct DQN VOR/DME and hold.
Simultaneous approach authorized. For inop ALS, increase S-LOC 24R Cat A/B visibility to 1 SM; increase Cat C/D visibility to 1½ SM.		

ATIS	COLUMBUS APP CON	DAYTON TOWER	GND CON
125.8	118.85 305.2 (091°-180°)	119.9 257.7	121.9
	134.45 323.15 (181°-090°)		

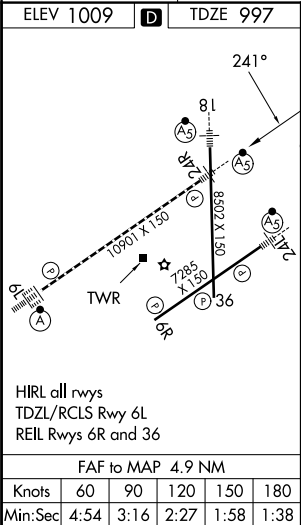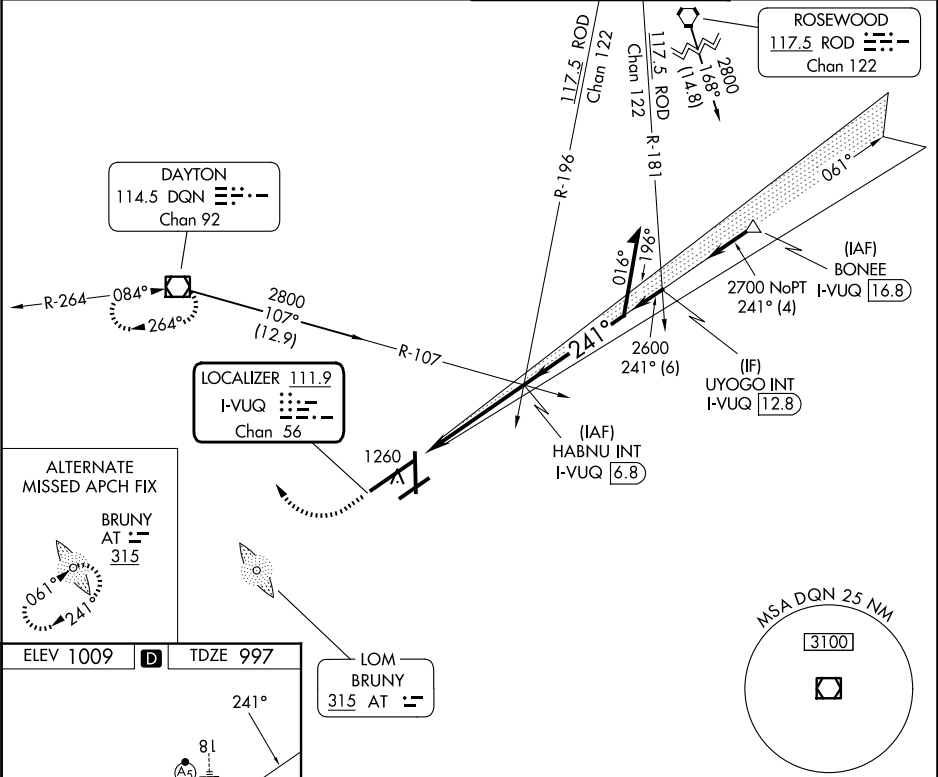

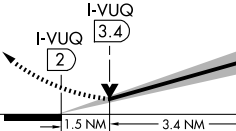3000 ↑		DQN 	HABNU INT I-VUQ <u>6.8</u>		Remain within 10 NM
		2600	061°	2800	GS 3.00° TCH 55
I-VUQ <u>2</u>		2600	241°	2600	
CATEGORY	A	B	C	D	
S-ILS 24R	1203/24		206 (200-½)		
S-LOC 24R	1520/24	523 (600-½)	1520/55	523 (600-1)	
CIRCLING	1580-1	571 (600-1)	1580-1½ 571 (600-½)	1640-2 631 (700-2)	

EC-2, 01 OCT 2026 to 29 OCT 2026

EC-2, 01 OCT 2026 to 29 OCT 2026