



LOC/DME I-SMR 111.3 Chan 50	APP CRS 032°	Rwy Ldg 10502 TDZE 3680 Apt Elev 3680	ILS RWY 3 (CAT II & III) GREAT FALLS INTL (GTF)
--	------------------------	--	--

CAT II: RVR 1000 authorized with specific OPSPEC, MSPEC, or LOA approval and use of autoland or HUD to touchdown. DME required.	ALSf-2 	MISSED APPROACH: Climb to 5000 then climbing right turn to 8300 direct GTF VORTAC then on GTF VORTAC R-209 to FRYMNI/I-SMR 16.9 DME and hold.
--	---	---

ATIS 126.6 269.0	GREAT FALLS APP CON 128.6 379.175	GREAT FALLS TOWER 118.7 282.2	GND CON 121.7 348.6
----------------------------	---	---	-------------------------------

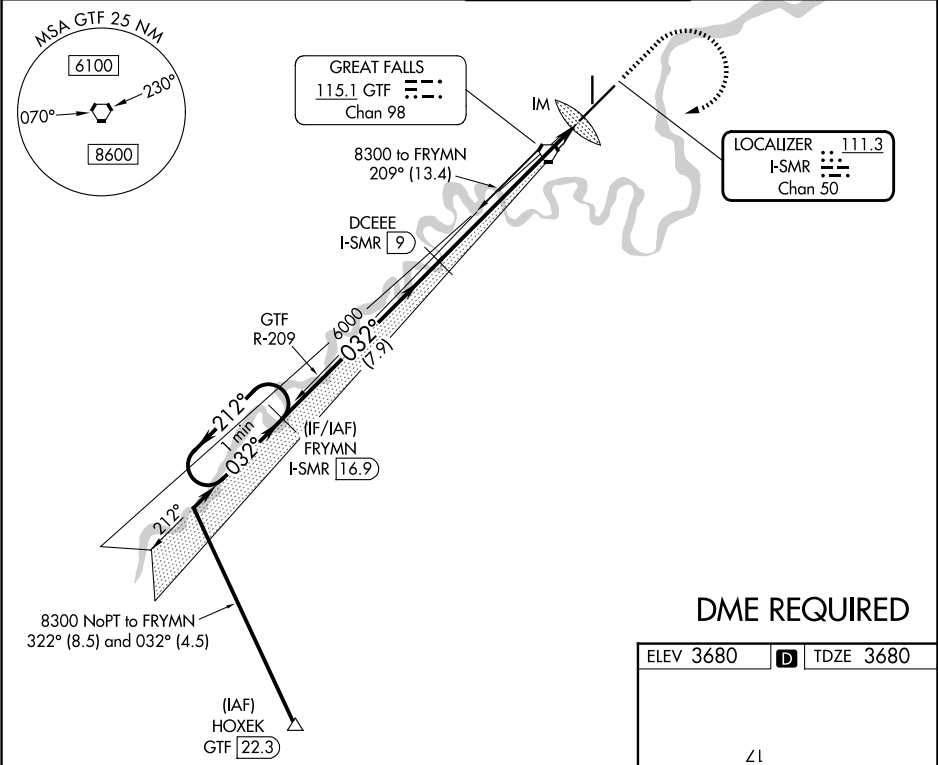

DME REQUIRED

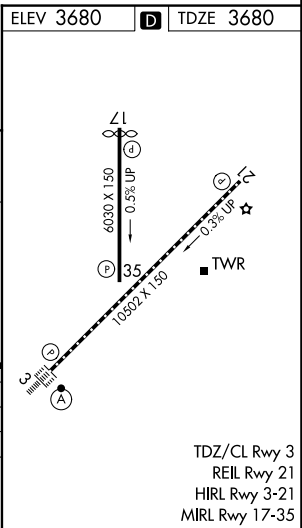

VGSI and ILS glidepath not coincident (VGSI Angle 3.00/TCH 70).					5000 ↑	8300 ↗	GTF 	GTF R-209	FRYMN I-SMR 16.9
One Minute Holding Pattern					Use I-SMR DME when on the localizer course.				
8300 ← 212° 032° → 6000 GS 3.00° TCH 54					DCEEE I-SMR 9 6000 IM 3780 7.9 NM 7.1 NM 1099'				
CATEGORY	A	B	C	D					
S-ILS 3	CAT II RA 96/12 100 DA 3780								
S-ILS 3	CAT III RVR 06								
CATEGORY II & III ILS - SPECIAL AIRCREW & AIRCRAFT CERTIFICATION REQUIRED									