

VORTAC BFM <u>116.35</u> Chan 110(Y)	APP CRS 333°	Rwy Ldg 9618 TDZE 25 Apt Elev 26
--	------------------------	---


VOR RWY 32
MOBILE INTL (BFM)

T When local altimeter setting not received, use Mobile Rgnl altimeter setting and increase all MDAs 60 feet. For inop MALSR, increase S-32 Cats C/D visibility to 1 $\frac{3}{4}$ SM. For inop MALSR when using Mobile Rgnl altimeter setting, increase S-32 Cats C/D visibility to 1 $\frac{5}{8}$ SM.




MISSED APPROACH: Climb to 600 then climbing right turn to 2000 via heading 040° and BFM VORTAC R-031 to STETS INT and hold.

ATIS 135.575	MOBILE APP CON ★ 118.5 269.3	INTERNATIONAL TOWER★ 118.8 (CTAF) 0 251.1	GND CON 121.7 239.3	UNICOM 122.95
-----------------	---------------------------------	--	------------------------	------------------

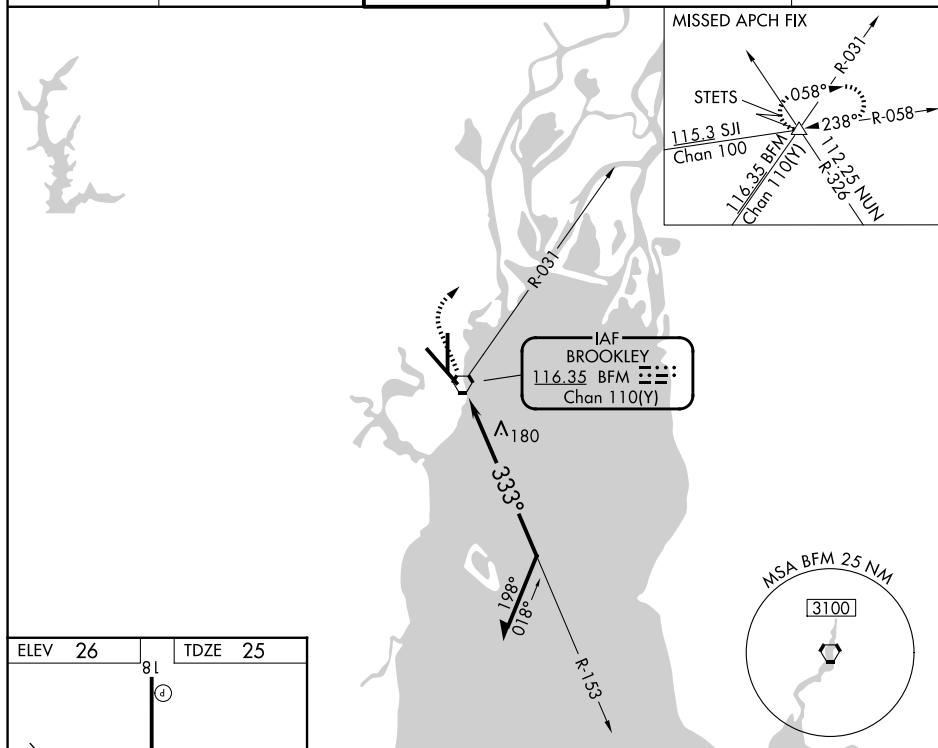

REIL Rwy 14
MIRL Rwy 18-36
HIRL Rwy 14-32
TDZL/RCLS Rwy 32

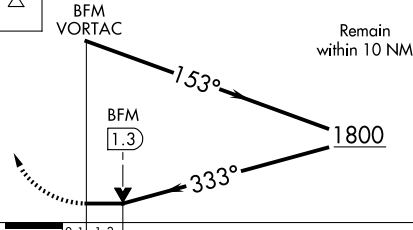600 ↑	2000 hdg 040°	BFM R-031 △				
CATEGORY	A	B	C	D		
S-32	540/24	515 (600-½)	540/55	515 (600-1)		
CIRCLING	680-1	654 (700-1)	680-1¾ 654 (700-1¾)	1100-3 1074 (1000-3)		