

VORTAC RIC	APP CRS	Rwy Ldg	6607
114.1	188°	TDZE	168
Chan 88		Apt Elev	168




VOR RWY 20
RICHMOND INTL (RIC)

RADAR required for procedure entry. DME or RADAR required.

MISSED APPROACH: Climbing right turn to 2000 on RIC R-223 to MATOX INT/RIC 16.3 DME and hold.

Rwy 20 helicopter visibility reduction below ¾ SM NA.

ATIS	POTOMAC APP CON	RICHMOND TOWER	GND CON
119.15 263.025	126.4 282.375 (001°-185°) 126.75 307.2 (186°-360°)	121.1 257.8	121.9 348.6

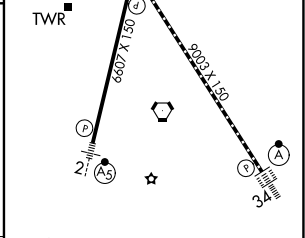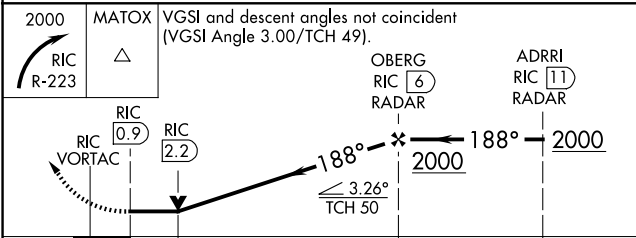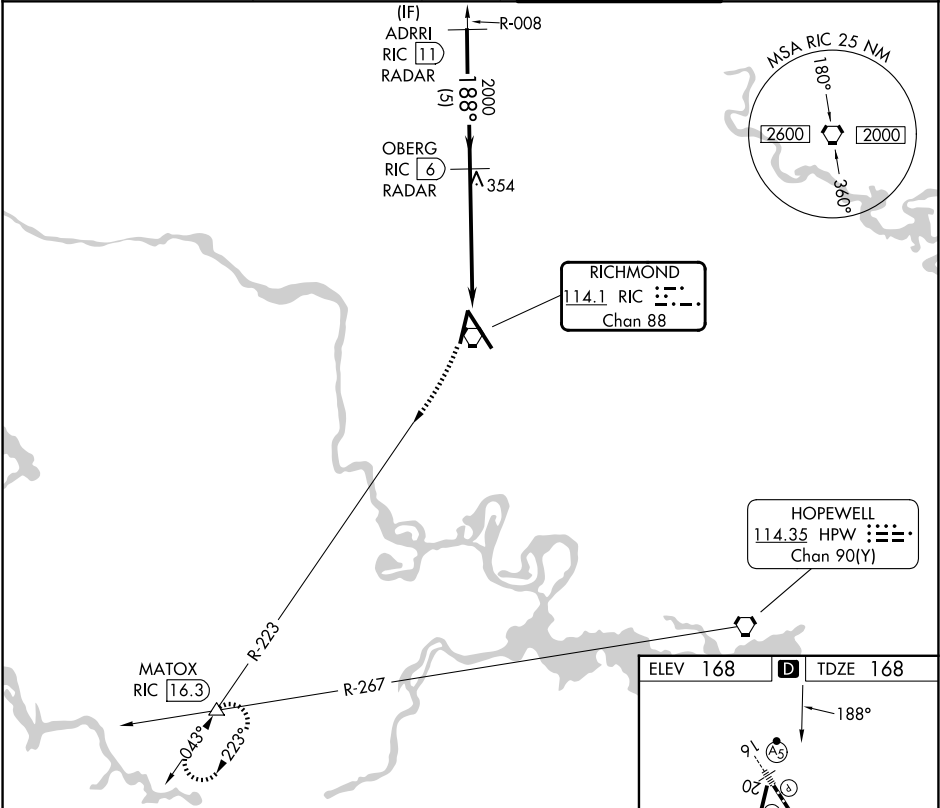

	1.4	3.8 NM		5 NM		TDZ/CL Rwy 34 HIRL Rwys 2-20 and 16-34 REIL Rwy 20				
CATEGORY	A	B	C		D					
S-20	660-1	492 (500-1)	660-1 3/8		492 (500-1 3/8)					
						FAF to MAP 5.2 NM				
CIRCLING	660-1	492 (500-1)	700-1 1/2 532 (600-1 1/2)		720-2 552 (600-2)					
	Knots	60	90	120	150	180				
	Min:Sec	5:12	3:28	2:36	2:05	1:44				