


SIoux FALLS, SOUTH DAKOTA

HI-ILS or LOC RWY 21


LOC FQJ 111.1	APCH CRS 210°	Rwy Idg 8999 TDZE 1430 Arpt Elev 1430	AL-396 [USAF]	JOE FOSS FLD (KFSD)
DME required. RADAR required for procedure entry.			MALSR 	MISSED APPROACH: Climb to 3400 then climbing right turn to 5000 on heading 300° and FSD R-269 to FYRE 15 DME and hold.
*** When ALS inop, increase RVR to 40 and vis to $\frac{3}{4}$ miles. ** When ALS inop, increase CAT CDE vis to $\frac{1}{8}$ miles.				

ATIS 126.6	SIoux FALLS APP CON 125.8 306.2	SIoux FALLS TOWER ★ 118.3(CTAF) 257.8	GND CON 121.9 348.6	ASR
---------------	------------------------------------	--	------------------------	-----

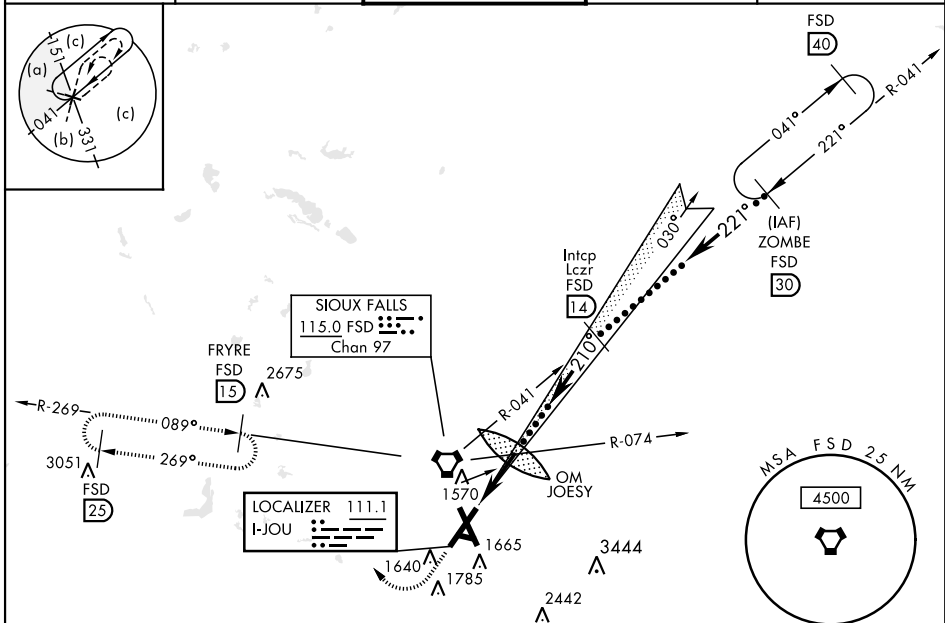

EMERG SAFE ALT 100 NM 4600

3400 ↑	5000 hdg 300°	FSD R-269	FRYRE FSD 15	Intcp Lczr 14	ZOMBE 30
-----------	---------------------	--------------	--------------------	---------------------	-------------

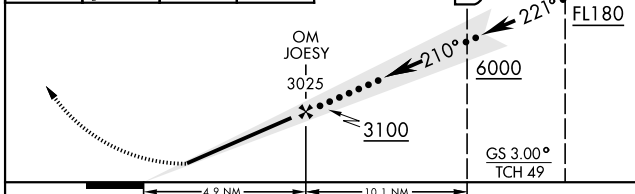

CATEGORY	C	D	E
S-ILS 21*	1630/18	200	(200-½)
S-LOC 21**	1920/50	490 (500-1)	1920/60 490 (500-½)
C CIRCLING	2060-1¼ 630 (700-1¼)	2200-2½ 770 (800-2½)	2300-3 870 (900-3)

SIOUX FALLS, SOUTH DAKOTA

43° 35' N-96° 45' W

JOE FOSS FLD (KFSD)

Amdt 6C 04NOV21

HI-ILS or LOC RWY 21