
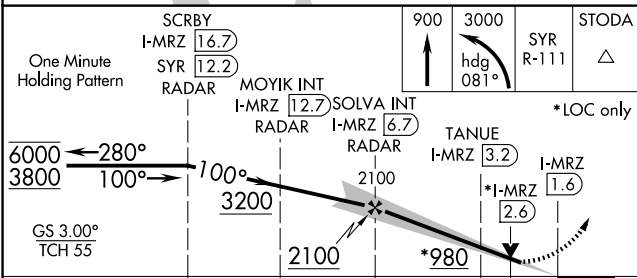


|                                                 |                        |                                                   |             |
|-------------------------------------------------|------------------------|---------------------------------------------------|-------------|
| LOC/DME I-MRZ<br><b>109.9</b><br>Chan <b>36</b> | APP CRS<br><b>100°</b> | Rwy Ldg<br>TDZE <b>421</b><br>Apt Elev <b>421</b> | <b>9013</b> |
|-------------------------------------------------|------------------------|---------------------------------------------------|-------------|

ILS or LOC RWY 10  
SYRACUSE HANCOCK INTL (SYR)

|                                                                                                                                                             |           |                                                                                                                                                         |
|-------------------------------------------------------------------------------------------------------------------------------------------------------------|-----------|---------------------------------------------------------------------------------------------------------------------------------------------------------|
| DME or RADAR required.                                                                                                                                      | MALSR<br> | MISSED APPROACH: Climb to 900 then climbing left turn to 3000 on heading 081° and on SYR VORTAC R-111 to STODA INT/ SYR VORTAC 15.5 DME/RADAR and hold. |
| TANUE fix minimums, for inoperative ALS, increase S-LOC 10 Cats C and D visibility to RVR 5500.<br>**RVR 1800 authorized with use of FD or AP or HUD to DA. |           |                                                                                                                                                         |

|                        |                                            |                                      |                               |
|------------------------|--------------------------------------------|--------------------------------------|-------------------------------|
| ATIS<br><b>124.225</b> | SYRACUSE APP CON<br><b>126.125 269.125</b> | SYRACUSE TOWER<br><b>120.3 239.0</b> | GND CON<br><b>121.7 348.6</b> |
|------------------------|--------------------------------------------|--------------------------------------|-------------------------------|

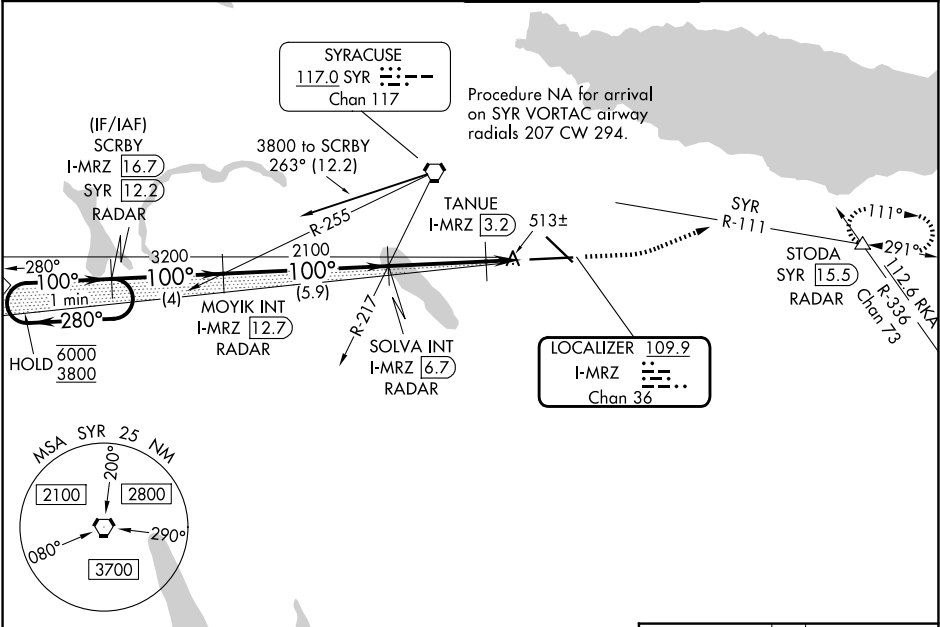

|                                                                      |          |
|----------------------------------------------------------------------|----------|
| ELEV 421                                                             | TDZE 421 |
| *LOC only                                                            |          |
| TANUE FIX MINIMUMS (DME REQUIRED)                                    |          |
| S-LOC 10 780/24 359 (400-½) 780/30 359 (400-¾)                       |          |
| CIRCLING 900-1 479 (500-1) 920-1 499 (500-1)                         |          |
| S-LOC 10 980/24 559 (600-½) 980/60 559 (600-1¼)                      |          |
| CIRCLING 980-1 559 (600-1) 1020-1½ 599 (600-1½) 1180-2½ 759 (800-2½) |          |
| TANUE FIX MINIMUMS (DME REQUIRED)                                    |          |
| S-LOC 10 780/24 359 (400-½) 780/30 359 (400-¾)                       |          |
| CIRCLING 900-1 479 (500-1) 920-1 499 (500-1)                         |          |
| S-LOC 10 980/24 559 (600-½) 980/60 559 (600-1¼)                      |          |
| CIRCLING 980-1 559 (600-1) 1020-1½ 599 (600-1½) 1180-2½ 759 (800-2½) |          |