ILS RWY 1L (SA CAT I)
TAMPA INTL (TPA)

LOC/DME I-AMP	APP CRS	Rwy Ldg 10800
108.9	007°	TDZE 11
Chan 26		Apt Elev 26

DME and RADAR required.

Simultaneous approach authorized. Requires specific OPSPEC, MSPEC, or LOA approval and use of HUD to DH.

ALSF-2

MISSED APPROACH: Climb to 500 then climbing left turn to 2000 direct PIE VORTAC and hold, continue climb-in-hold to 2000. (TACAN aircraft climb to 500 then climbing left turn to 2000 direct PIE VORTAC then on PIE VORTAC R-276 to LAFAL INT/PIE 8 DME and hold W, RT, 096° inbound).

D-ATIS	TAMPA APP CON	TAMPA TOWER	GND CON
126.45	118.5 307.175	119.5 269.4	121.7 269.4

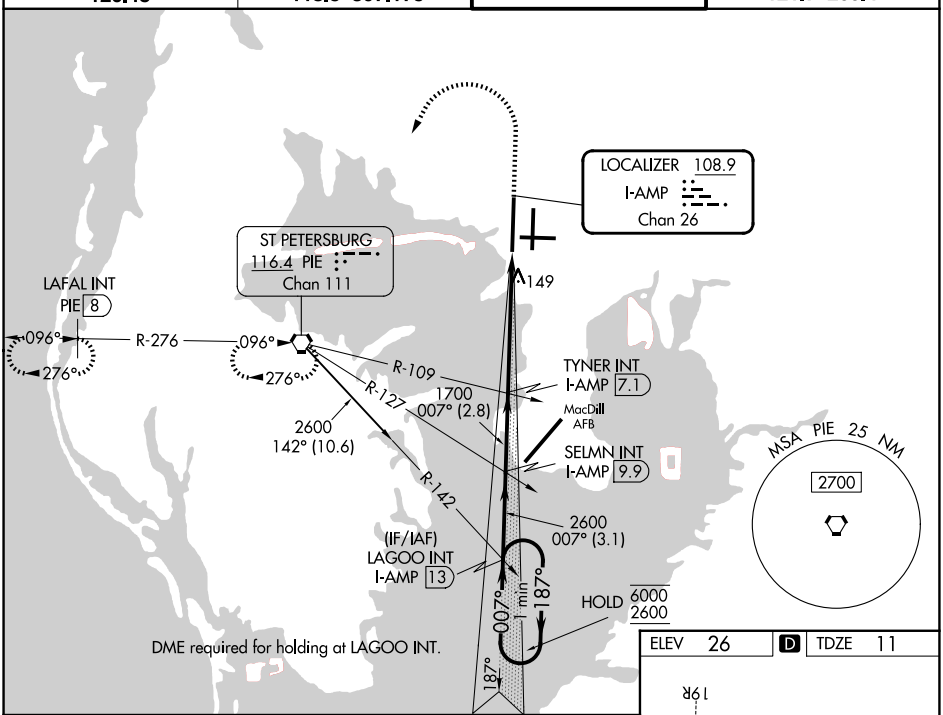

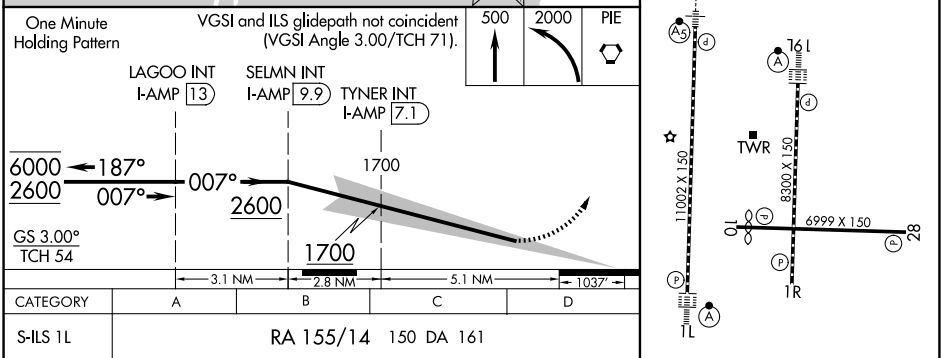

CATEGORY	A	B	C	D
S-ILS 1L	RA 155/14 150 DA 161			

SA CATEGORY I ILS - SPECIAL AIRCREW & AIRCRAFT CERTIFICATION REQUIRED

REIL Rwy 1R
HIRL Rwys 1L-19R, 1R-19L, and 10-28
TDZL/RCLS Rwys 1L and 19L

SE-3, 01 OCT 2026 to 29 OCT 2026

SE-3, 01 OCT 2026 to 29 OCT 2026