
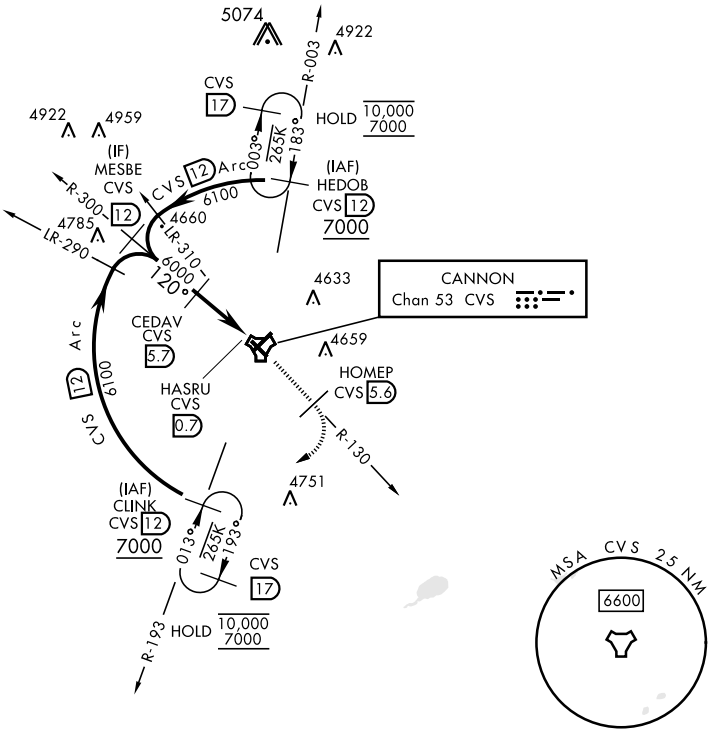
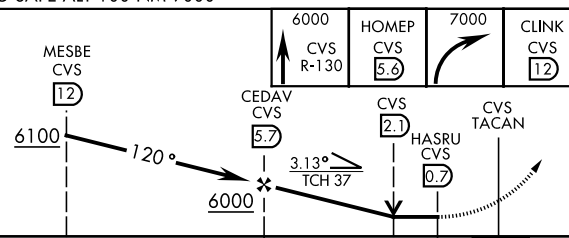


TACAN RWY 13

TACAN CVS Chan 53	APCH CRS 120°	Rwy Idg 8194 TDZE 4294 Arpt Elev 4295	[USAF]	CANNON AFB (KCVS)
Missed approach requires use of RNAV or RADAR monitoring.			MALSR (A5)	MISSED APPROACH: Climb to 6000 out CVS TACAN R-130 to 5.6 DME (HOMEP) then turn right climbing to 7000 intercept CVS R-193 to 12 DME (CLINK) and hold.
▼ * When ALS inop, increase CAT AB vis to 1 mile, CAT CDE vis to 1¾ miles.				
ATIS 119.1 269.9	APP CON 118.425 352.1	TOWER 120.4 270.25	GND CON 121.9 275.8	

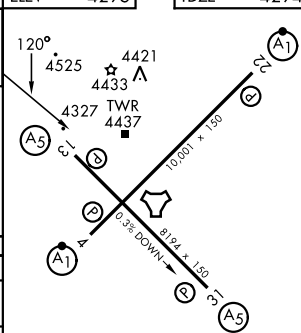

EMERG SAFE ALT 100 NM 9000					ELEV 4295	TDZE 4294
						
CATEGORY	A	B	C	D	E	
S-13*	4800-¾	506 (600-¾)	4800-1	506	(600-1)	
CIRCLING	4840-1	545 (600-1)	4860-1½ 565 (600-1½)	5000-2¼ 705 (800-2¼)	5020-2½ 725 (800-2½)	HIRL all rwys