

CLOVIS, NEW MEXICO

TACAN RWY 4

TACAN CVS Chan 53	APCH CRS 048°	Rwy ldg TDZE Arpt Elev	10,001 4284 4295
----------------------	------------------	------------------------------	------------------------


(USAF)

CANNON AFB (KCVS)

Missed approach requires use of RNAV or ATC radar monitoring.
* When ALS inop, increase CAT AB RVR to 55, vis to 1 mile; CAT CDE RVR to 60, vis to 1 1/8 miles.

ALSF-1
MISSED APPROACH: Climb to 6000 via CVS TACAN R-036 to 5.1 DME (FETEP), cross FETEP at or below 6000, then turn left climbing to 7000 to intercept CVS TACAN R-003 to 12 DME (HEDOB) and hold.

ATIS 119.1 269.9	CANNON APP CON 118.425 352.1	TOWER 120.4 270.25	GND CON 121.9 275.8
---------------------	---------------------------------	-----------------------	------------------------

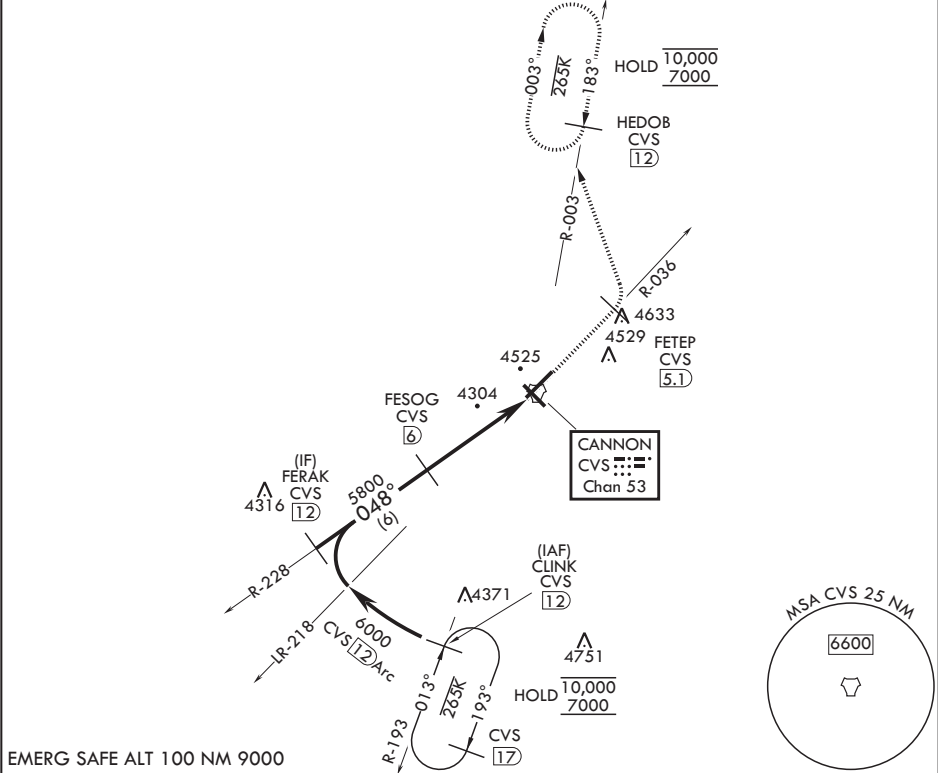

EMERG SAFE ALT 100 NM 9000

FERAK 12	6000	048°	FESOG 6	5800	2.57° ≥ TCH 41	5.5 NM	MINRE 5	TACAN	6000	FETEP CVS 5.1	7000	HEDOB CVS 12	ELEV 4295	TDZE 4284
CATEGORY	A	B	C	D	E									
S-4*	4700/24	416 (500-½)	4700/40	416 (500-¾)										
CIRCLING	4840-1	545 (600-1)	4860-1½ 565 (600-1½)	5000-2¼ 705 (800-2¼)	5020-2½ 725 (800-2½)									

CLOVIS, NEW MEXICO

34°23'N - 103°19'W

CANNON AFB (KCVS)

Amdt 3 10OCT19

TACAN RWY 4

SW-1, 01 OCT 2026 to 29 OCT 2026

SW-1, 01 OCT 2026 to 29 OCT 2026