

26022

ILS RWY 36L (CAT II)
CINCINNATI/NORTHERN KENTUCKY INTL (CVG)




ALCE 2

DME or RADAR required. RADAR required for procedure entry at TMORE.



MISSED APPROACH: Climb to 1300 then climbing left turn to 4000 on heading 260° and on FLM VOR/DME R-314 to JADRO/FLM 43.3 DME/RADAR and hold.

D-ATIS 134.375	CININNATI APP CON 119.7 363.15 (090°-269°) 123.875 363.15 (270°-089°)	CININNATI TOWER 118.975 360.85 (18L/36R) 118.3 (9/27, 18C/36C)	GND CON 121.7
--------------------------	---	--	-------------------------

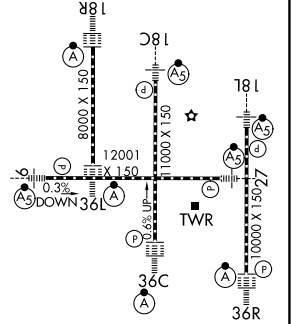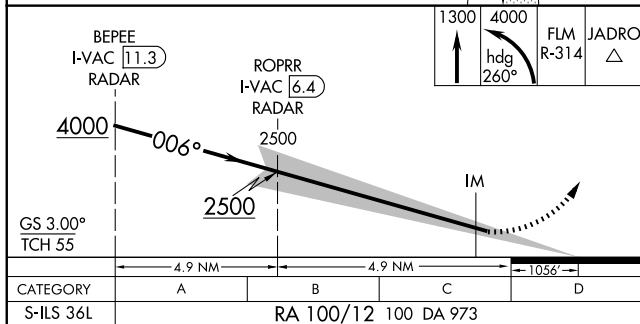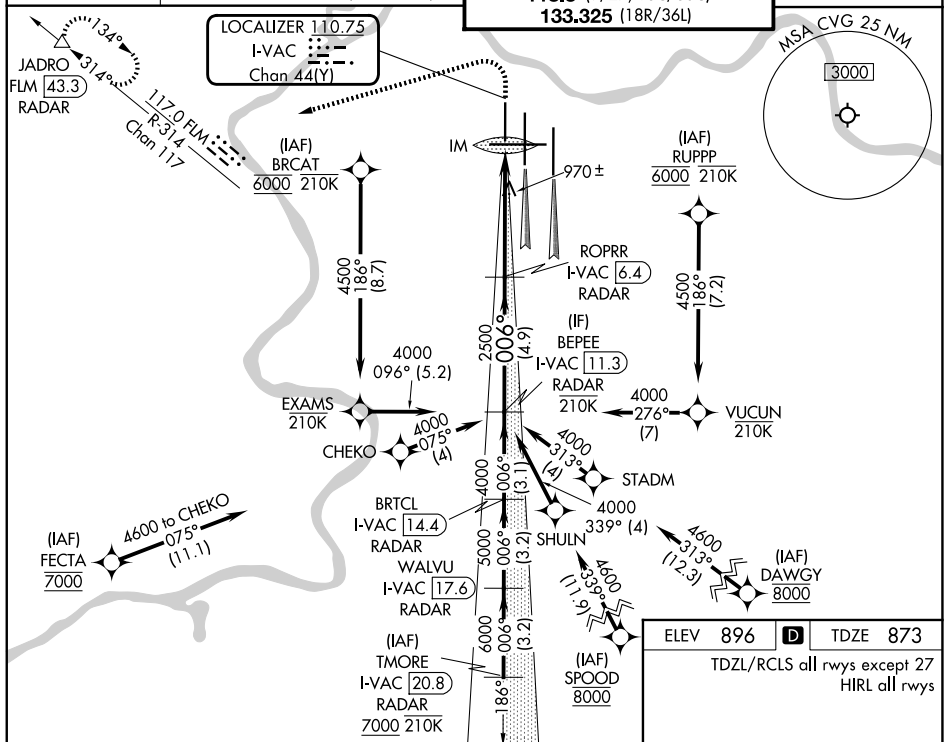

CATEGORY II ILS - SPECIAL AIRCREW
& AIRCRAFT CERTIFICATION REQUIRED

CINCINNATI/NORTHERN KENTUCKY INTL (CVG)
39°03'N-84°40'W ILS D/W 341 (CAT II)

ILS RWY 36L (CAT II)

SE-1, 01 OCT 2026 to 29 OCT 2026