

SAN JOSE, CALIFORNIA

AL-693 (FAA)

26246

LOC/DME I-SJC 110.9 Chan 46	APP CRS 306°	Rwy Ldg 7614 TDZE 57 Apt Elev 62
---	------------------------	---

ILS RWY 30L (SA CAT I & II)

MINETA SAN JOSE INTL (SJC)



RNAV 1-GPS or RADAR required for procedure entry. DME required.
From BORED: RNAV 1-GPS required.

MALSI

MISSED APPROACH: Climb to 1900 on SJC VOR/DME R-303 to ARTAQ INT/SJC 7 DME and hold.

T SA CAT I: Requires specific OPSPEC, MSPEC, or LOA approval and use of HUD to DH.
A SA CAT II: Reduced lighting: requires specific OPSPEC, MSPEC, or LOA approval and use of autoland or HUD to touchdown. SA CAT I /II: Procedure NA when tower closed.

D-ATIS 126.95	NORCAL APP CON 120.1 290.25	SAN JOSE TOWER ★ 124.0 (CTAF) 0 257.6	GND CON 121.7	UNICOM 122.95
------------------	--------------------------------	--	------------------	------------------

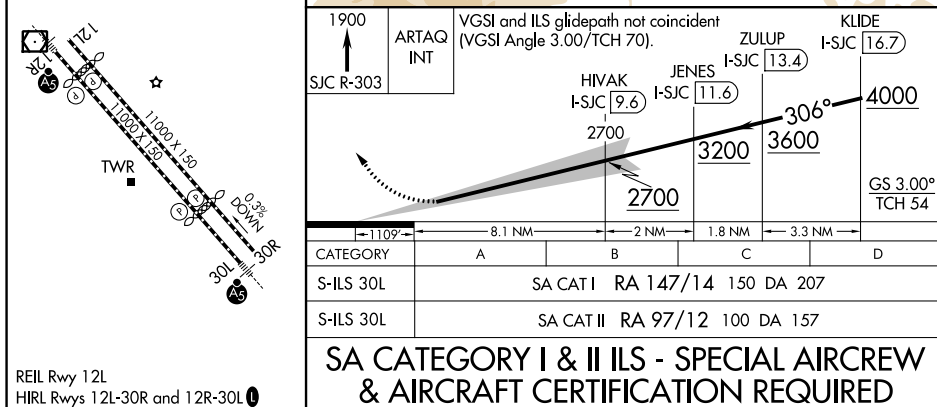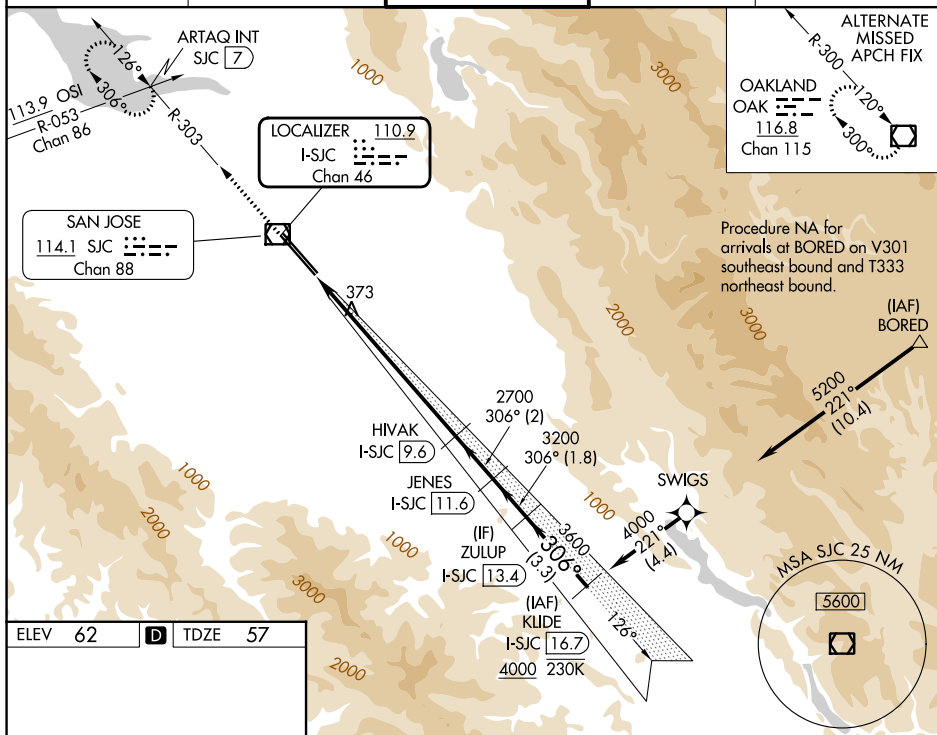

SAN JOSE, CALIFORNIA
Amdt 26 10SEP20

MINETA SAN JOSE INTL (SJC)

37°22'N-121°56'W

ILS RWY 30L (SA CAT I & II)

SW-2, 01 OCT 2026 to 29 OCT 2026

SW-2, 01 OCT 2026 to 29 OCT 2026