

TACAN RWY 5

TACAN NCA Chan 101	APCH CRS 064°	Rwy Idg 5126 TDZE 26 Arpt Elev 26
------------------------------	-------------------------	--


[USN] NEW RIVER MCAS (MCCUTCHEON FLD) (KNCA)

RADAR required

T RNAV substitution not authorized for holding.


MISSED APPROACH: Climb to 1500 then left turn to intercept NCA TACAN R-244 to WADEL/4.5 DME and hold.

ATIS ★ 134.325 288.325	CERRY POINT APP CON 119.35 377.175	TOWER ★ 134.95(CTAF) 0★ 360.2	GND CON 121.8 254.275	ASR/PAR
---------------------------	---------------------------------------	----------------------------------	--------------------------	---------

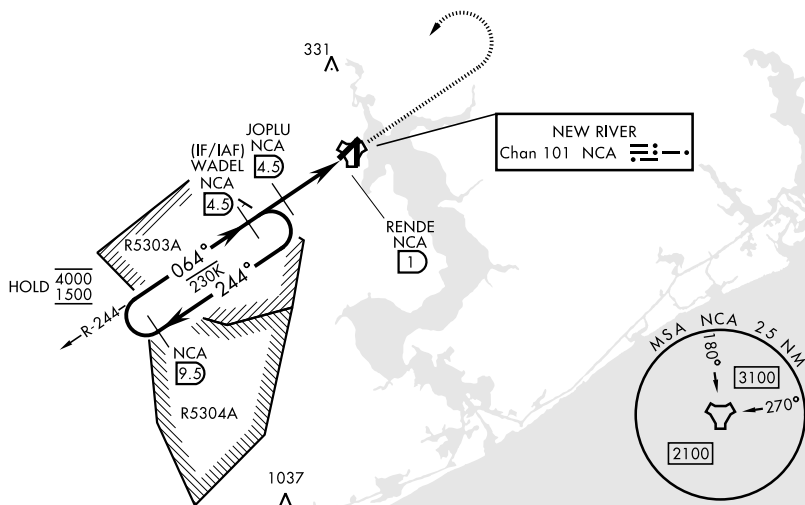


EMERG SAFE ALT 100 NM 3400

VGSI and descent angles not coincident
(VGSI Angle 3.00/TCH 37).

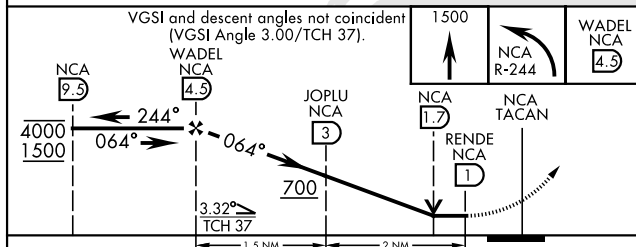

CATEGORY	A	B	C	D
S-5	480-1	454 (500-1)	480-1 $\frac{3}{4}$	454 (500-1 $\frac{3}{4}$)
CIRCLING	540-1	514 (600-1)	700-2 674 (700-2)	700-2 $\frac{1}{4}$ 674 (700-2 $\frac{1}{4}$)

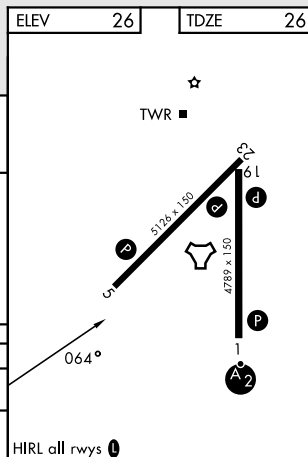

JACKSONVILLE, NORTH CAROLINA

34°43'N-77°26'W

NEW RIVER MCAS (MCCUTCHEON FLD) (KNCA)

Amdt 6 03SEP26

TACAN RWY 5

SE-2, 01 OCT 2026 to 29 OCT 2026