

LOC I-BAL 109.7	APP CRS 105°	Rwy Ldg 9953 TDZE 143 Apt Elev 143
---------------------------	------------------------	---



BALTIMORE/ WASHINGTON INTL THURGOOD MARSHALL (BWI) **ILS RWY 10 (CAT II & III)**

RADAR required for procedure entry. DME or RADAR required.	ALSIF-2 	MISSED APPROACH: Climb to 2500 on BAL VORTAC R-105 to HURTZ/BAL 12.3 DME/RADAR and hold.
---	-------------	---

D-ATIS 115.1 127.8	POTOMAC APP CON (020°-100°) 119.7 290.475 (131°-180°) (101°-130°) 128.7 307.9 (181°-019°)	BALTIMORE TOWER 119.4 257.8	GND CON 121.9
------------------------------	---	---------------------------------------	-------------------------

ALTERNATE MISSED
APCH FIX

WESTMINSTER
EMI
117.9
Chan 126

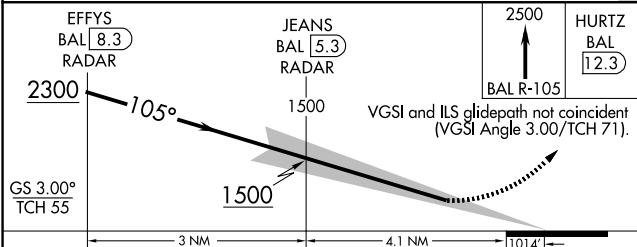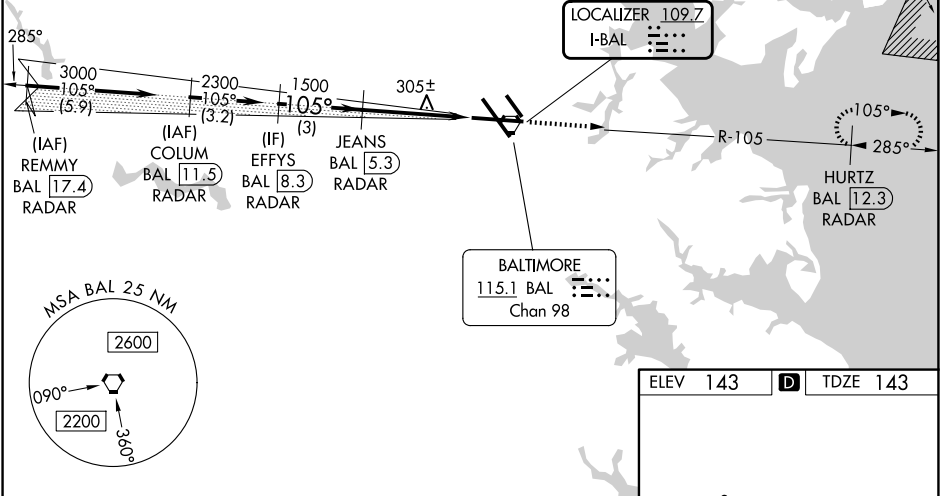

CATEGORY	A	B	C	D
S-ILS 10	CAT II RA 105/12 100 DA 243			
S-ILS 10	CAT III RVR 06			

**CATEGORY II & III ILS - SPECIAL AIRCREW
& AIRCRAFT CERTIFICATION REQUIRED**

ELEV 143 **D** TDZE 143

TDZL/RCLS Rwy 10 and 33L
REIL Rwy 15L and 33R
HIRL all rwy's

NE-3, 01 OCT 2026 to 29 OCT 2026

NE-3, 01 OCT 2026 to 29 OCT 2026