

LOC/DME I-RVZ
111.5
Chan **52**

APP CRS
358°

Rwy Ldg **9400**
TDZE **36**
Apt Elev **36**

ILS RWY 36L (SA CAT I & II)
VALLEY INTL (HRL)


RNP APCH-GPS.
DME required.

SA CAT I/II: Requires specific OPSPEC, MSPEC, or LOA approval.

MALSR

MISSED APPROACH: Climb to 2000 direct ZIPIV and hold.

ATIS 124.85	VALLEY APP CON 120.7 279.5	HARLINGEN TOWER ★ 119.3 (CTAF) 317.6	GND CON 121.7	UNICOM 122.95
-----------------------	--------------------------------------	--	-------------------------	-------------------------

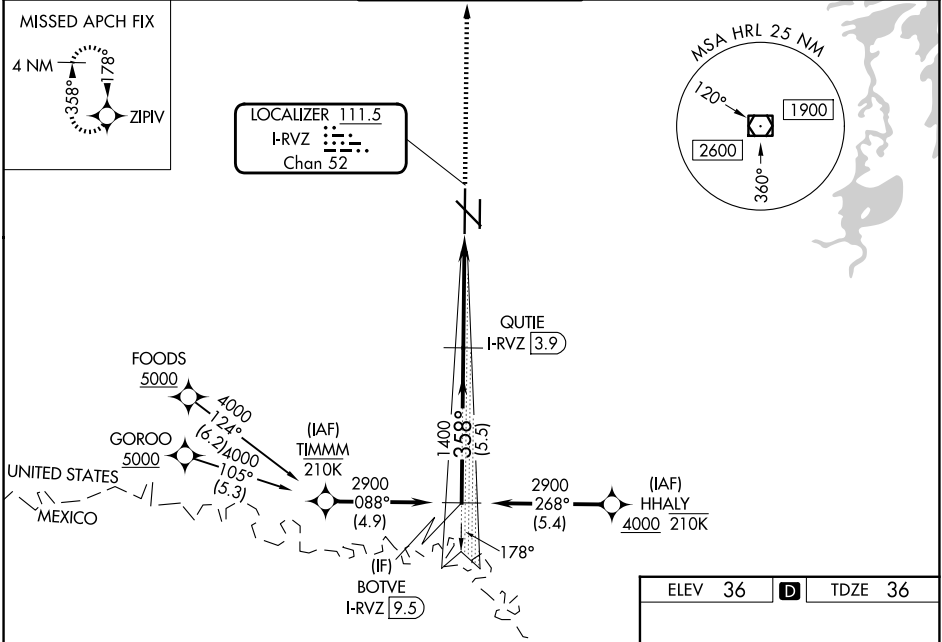

VGSI and ILS glidepath not coincident (VGSI Angle 3.00/TCH 74).
2000 ZIPIV
↑

BOTVE I-RVZ 9.5
QUTIE I-RVZ 3.9
2900 358°
1400
GS 3.00°
TCH 55
5.5 NM 4.1 NM 1039'

CATEGORY	A	B	C	D
S-ILS 36L	SA CAT I RA 150/14 150 DA 186			
S-ILS 36L	SA CAT II RA 100/12 100 DA 136			

SA CATEGORY I & II ILS - SPECIAL AIRCREW & AIRCRAFT CERTIFICATION REQUIRED

ELEV 36 D TDZE 36

18L 18R 7257 X 150 5950 X 150 36L 36R 151
TWR 9400 X 150
MIRL Rwy 18L-36R
REIL Rwy 13 and 18L
HIRL Rwy 13-31 and 18R-36L