


VORTAC LAL 116.0 Chan 107	APP CRS 096°	Rwy Ldg 8500 TDZE 132 Apt Elev 142
---	------------------------	---

VOR RWY 10
LAKELAND LINDER INTL (LAL)

RADAR required for procedure entry. DME or RADAR required.		ALSf-2 	MISSED APPROACH: Climb to 1000 then climbing left turn to 2000 on heading 294° and on LAL VORTAC R-330 to PLUMY INT/ PIE 33.4 DME and hold.
	Circling NA to Rwys 8 and 26. Circling Rwy 28 NA at night. For inop ALS, increase S-10 Cat C/D visibility to 1½ SM; increase UDATE fix minimums S-10 Cat C/D visibility to RVR 6000.		

ATIS 118.025	TAMPA APP CON 120.65 290.3	LAKELAND TOWER 124.5 236.775	GND CON 121.4
------------------------	--------------------------------------	--	-------------------------

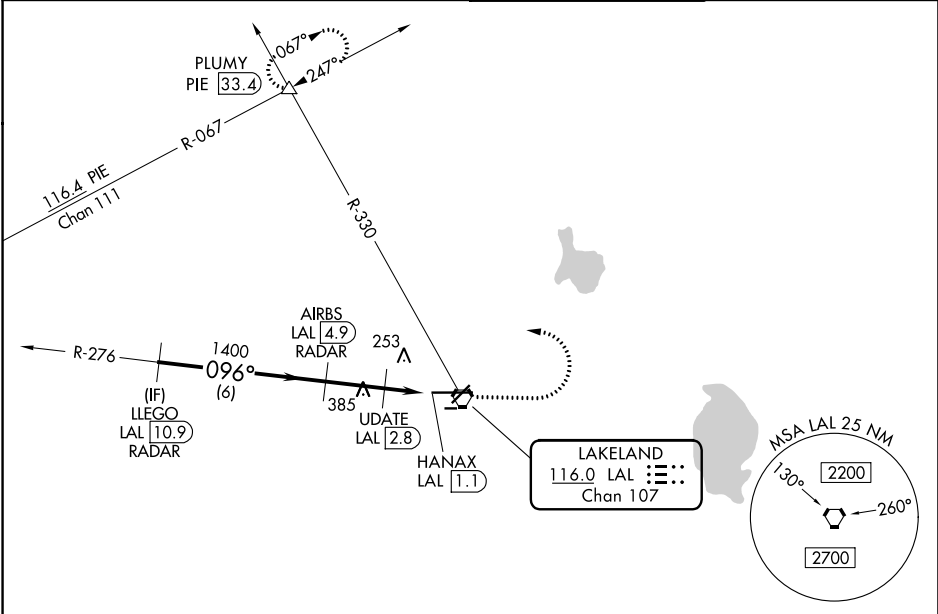

				ELEV 142		D		TDZE 132	
CATEGORY		A		B		C		D	
S-10		700/24		568 (600-1/2)		700-1 1/4		568 (600-1 1/4)	
CIRCLING		700-1		558 (600-1)		720-1 1/8		840-2 1/4	
						578 (600-1 1/8)		698 (700-2 1/4)	
UPDATE FIX MINIMUMS									
S-10		540/24		408 (400-1/2)		540/40		408 (400-3/4)	
CIRCLING		600-1		660-1		720-1 1/2		840-2 1/4	
		458 (500-1)		518 (600-1)		578 (600-1 1/2)		698 (700-2 1/4)	
TDZL/RCLS Rwy 10									
HIRL Rwys 5-23 and 10-28									
FAF to MAP 3.8 NM									
Knots		60		90		120		150	
Min:Sec		3:48		2:32		1:54		1:31	

SE-3, 01 OCT 2026 to 29 OCT 2026

SE-3, 01 OCT 2026 to 29 OCT 2026