

WAAS CH 65929 W01B	APP CRS 016°	Rwy Ldg 7302 TDZE 1321 Apt Elev 1333
--	------------------------	---

RNAV (GPS) RWY 1R

WICHITA DWIGHT D EISENHOWER NTL (ICT)


⚠ For uncompensated Baro-VNAV systems, LNAV/VNAV NA below -15°C (5°F) or above 54°C (130°F). For inoperative MALSR, increase LPV Cat E visibility to ¾, LNAV/VNAV Cat E visibility to 1½ and LNAV Cat C, D and E visibility to 1½. DME/DME RNP-0.3 NA. LNAV procedure NA during simultaneous operations. Simultaneous approach authorized with ILS or LOC RWY 1L and ILS RWY 1L (Cat III). Use of FD or AP providing RNAV track guidance required during simultaneous operations. # RVR 1800 authorized with use of FD or AP or HUD to DA.

MALSF

MISSED APPROACH:
Climb to 3600 direct
JAXSU and hold.

ATIS 125.15	WICHITA APP CON 126.7 353.5	WICHITA TOWER 118.2 257.8	GND CON 121.9 348.6
----------------	--------------------------------	------------------------------	------------------------

MISSED APCH FIX

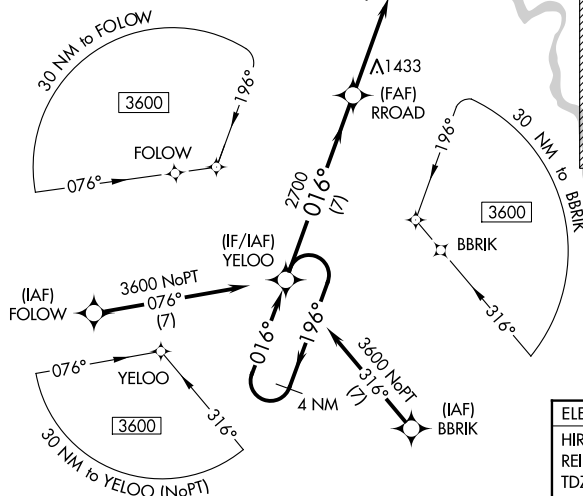

A-683

ELEV 1333	D	TDZE 1321
-----------	----------	-----------

HIRL all Rwys
REIL Rwy 14 and 32
TDZ/CL Rwy 1L

