

WAAS CH 67473 W08B	APP CRS 077°	Rwy Ldg 4000 TDZE 140 Apt Elev 143
--	------------------------	---

RNAV (GPS) Y RWY 8

MERRILL FLD (MRI) (PAMR)


RNP APCH - GPS.

⚠

When local altimeter setting not received, use ANC/PANC altimeter setting and increase LPV DA to 801 feet. Increase all MDAs 20 feet. Rwy 8: helicopter visibility reduction below 1 SM NA. Circling Rwy 17, 35, 5 and 23 NA at night.

MISSED APPROACH: Climb to 1000 then climbing left turn to 2000 direct BGQ VORTAC and hold.

ATIS 124.25	ANCHORAGE APP CON 119.1 363.2	MERRILL TOWER ★ 126.0 (CTAF) 0	GND CON 121.7	UNICOM 122.95
-----------------------	---	--	-------------------------	-------------------------

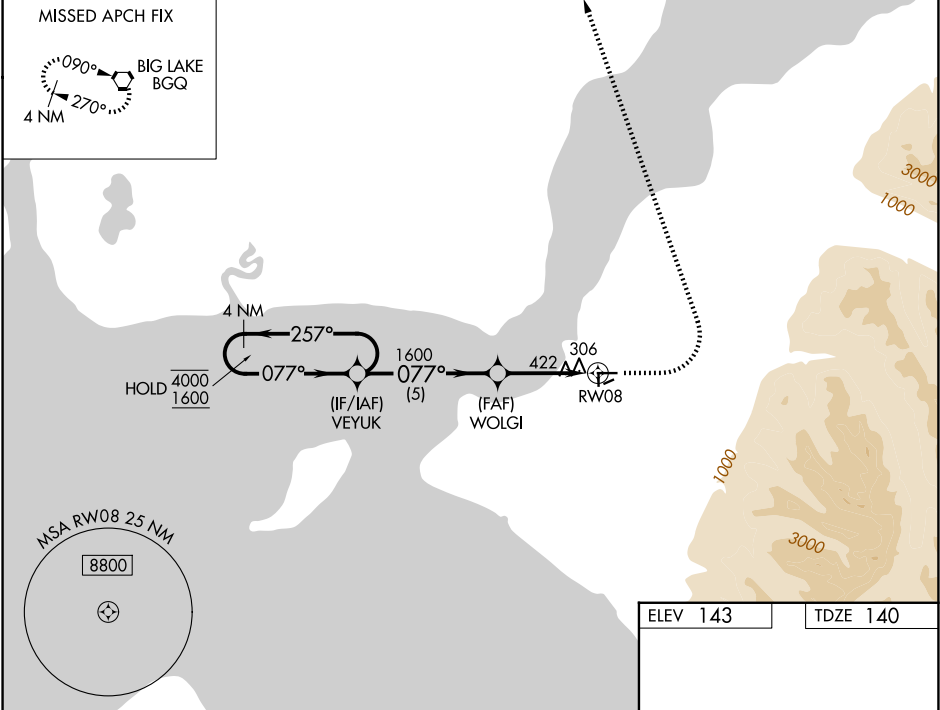

VGSI and RNAV glidepath not coincident
(VGSI Angle 3.50/TCH 29)

1000 2000 BGQ

4 NM Holding Pattern

VEYUK

WOLGI

1600

1600

GP 3.75°
TCH 43

5 NM

3.6 NM

RWY 8

ELEV 143

TDZE 140

077°

TWR

4000 X 100

0.3% UP

2640 X 75

0.3% UP

35

2000 X 60

23

CATEGORY	A	B	C	D
LPV DA	788-1 $\frac{7}{8}$	648 (700-1 $\frac{7}{8}$)	NA	NA
LNAV MDA	680-1	540 (600-1)	NA	NA
CIRCLING	740-1 597 (600-1)	800-1 657 (700-1)	NA	NA

REIL Rwy 8, 17, 26, and 35 0
MIRL Rwy 8-26 and 17-35 0