

YIGO, GUAM I, GUAM

TACAN Y RWY 06L

VORTAC UNZ 115.8 Chan T05	APCH CRS 053°	Rwy Idg TDZE Arpt Elev	10,527 539 617
---------------------------------	------------------	------------------------------	----------------------

(USAF)



ANDERSEN AFB (PGUA)

RADAR or DME required	SALS (A2)	MISSED APPROACH: Climb to 3000, intercept UNZ R-053 to HAAMR and hold.
* When ALS inop, increase CAT AB RVR to 55 and vis to 1 mile, CAT CDE vis to 1 1/2 miles. ** Circling not authorized NW of Rwy 06L-24R.		

ATIS 118.175 254.325	GUAM APP CON/DEP CON 119.8 269.0	TOWER 126.2 233.7	GND CON 121.7 275.8
-------------------------	-------------------------------------	----------------------	------------------------

CAUTION: Environmentally Sensitive Area Flights along Anderson cliff line restricted to 1000' AGL or above.

All touchdown zones have a 1.0% down slope.

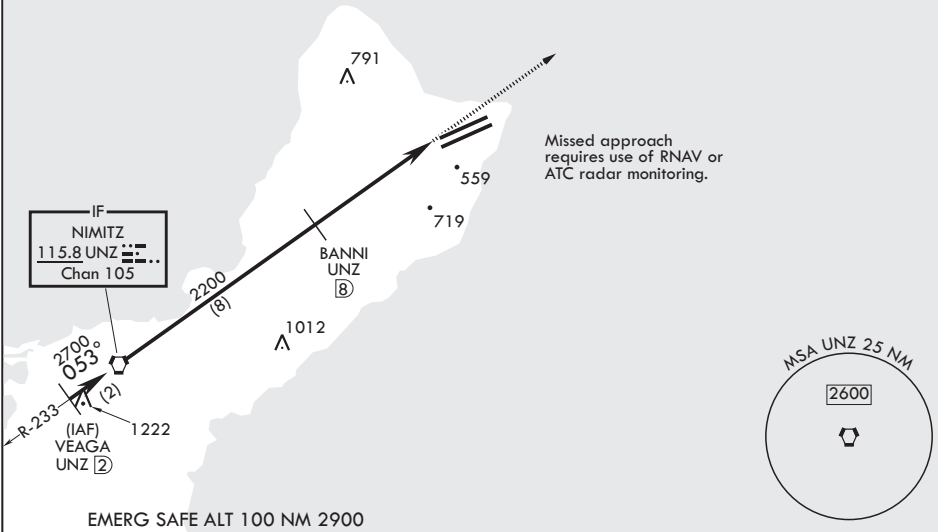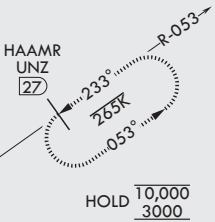

VEAGA UNZ 2	VORTAC	BANNI UNZ 8	FAYZR UNZ 12.8	HAAMR UNZ 27	ELEV 617	TDZE 539
2700	2700	2200	11.6	3000 UNZ R-053		
4.8 NM						
2.99° TCH 59						
CATEGORY	A	B	C	D	E	
S-6L*	1060/40	521 (500-¾)	1060-1¼	521	(500-1¼)	
CIRCLING**	1060-1 443 (500-1)	1080-1 463 (500-1)	1240-1¼ 623 (700-1¼)	1240-2 623 (700-2)	1240-2¼ 623 (700-2¼)	HIRL all rwys

YIGO, GUAM I, GUAM

13°35'N - 144°56'E

ANDERSEN AFB (PGUA)

Amdt 3 10AUG23
TERPS

TACAN Y RWY 06L