

YIGO, GUAM I, GUAM

TACAN Z RWY 06R

TACAN UAM Chan 54	APCH CRS 060°	Rwy Idg TDZE Arpt Elev	11,199 557 617
----------------------	------------------	------------------------------	----------------------

(USAF)


ANDERSEN AFB (PGUA)

RADAR or DME required	ALSF-1 	MISSED APPROACH: Climb to 3000, intercept UAM R-051 to FOVM and hold.
* When ALS inop, increase CAT AB RVR to 55, vis to 1 mile, CAT CDE vis to 1 3/8 miles. ** Circling not authorized NW of Rwy 06L-24R.		

ATIS 118.175 254.325	GUAM APP CON/DEP CON 119.8 269.0	TOWER 126.2 233.7	GND CON 121.7 275.8
-------------------------	-------------------------------------	----------------------	------------------------

CAUTION: Environmentally sensitive area flights along Andersen cliff line restricted to 1000' AGL or above.

All touchdown zones have a 1.0% down slope.

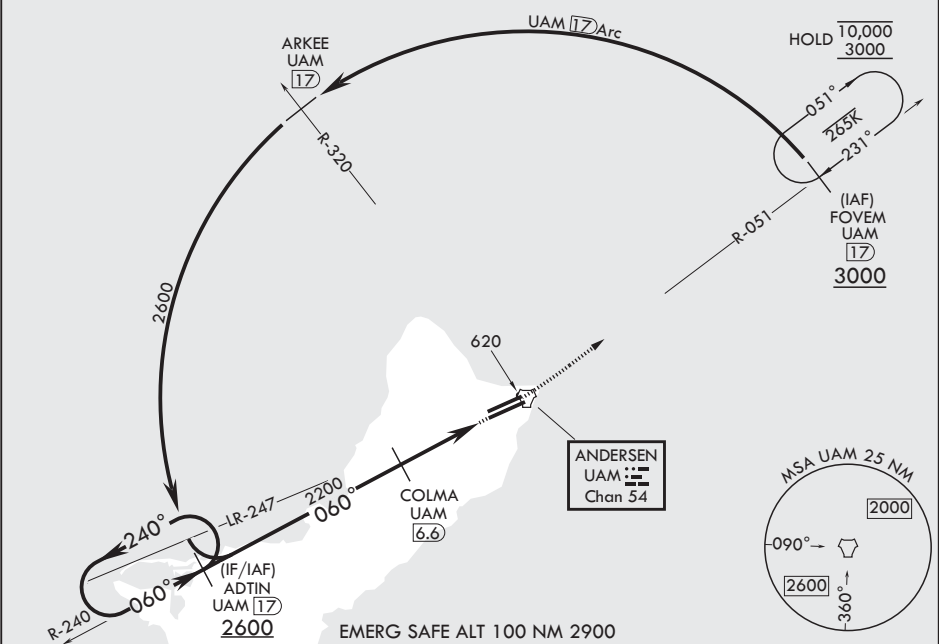

UAM ADTIN 17		VGSi and descent angles not coincident (VGSi angle 3.00/TCH 44).		3000 UAM R-051		FOVM UAM 17		ELEV 617		TDZE 557	
One minute holding pattern.		UAM COLMA 6.6		UAM FAXEL 2.5		UAM TACAN					
2200		3.28° TCH 43		4.1 NM		.5					
CATEGORY	A	B	C	D	E						
S-6R*	1040/24 483 (500-½)		1040/50 483 (500-1)								
CIRCLING**	1060-1 443 (500-1)	1080-1 463 (500-1)	1240-1¼ 623 (700-1¼)	1240-2 623 (700-2)	1240-2¼ 623 (700-2¼)						
						HIRL all rwys					

YIGO, GUAM I, GUAM

13°35'N - 144°56'E

ANDERSEN AFB (PGUA)

Amdt 3 14MAY26
TERPS

TACAN Z RWY 06R

PAC, 03 SEP 2026 to 29 OCT 2026

PAC, 03 SEP 2026 to 29 OCT 2026