

LOC/DME I-TLH
110.3
Chan **40**

APP CRS
004°

Rwy Ldg **7000**
TDZE **62**
Apt Elev **83**

ILS Z or LOC Z RWY 36
TALLAHASSEE INTL (TLH)



DME required. RADAR required for procedure entry at CVILL.

MALSR

MISSED APPROACH: Climb to 4000 direct SZW VORTAC and hold, continue climb-in-hold to 4000.

* RVR 1800 authorized with use of FD or AP or HUD to DA.

ATIS 119.45 239.25	TALLAHASSEE APP CON★ 135.8 317.4	TALLAHASSEE TOWER★ 118.7 (CTAF) 0 257.8	GND CON 121.9 348.6	UNICOM 123.075
------------------------------	--	---	-------------------------------	--------------------------

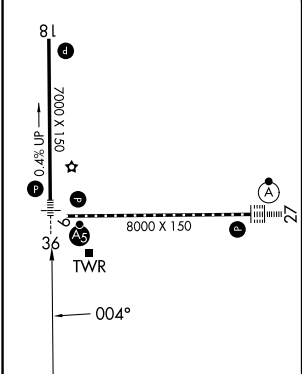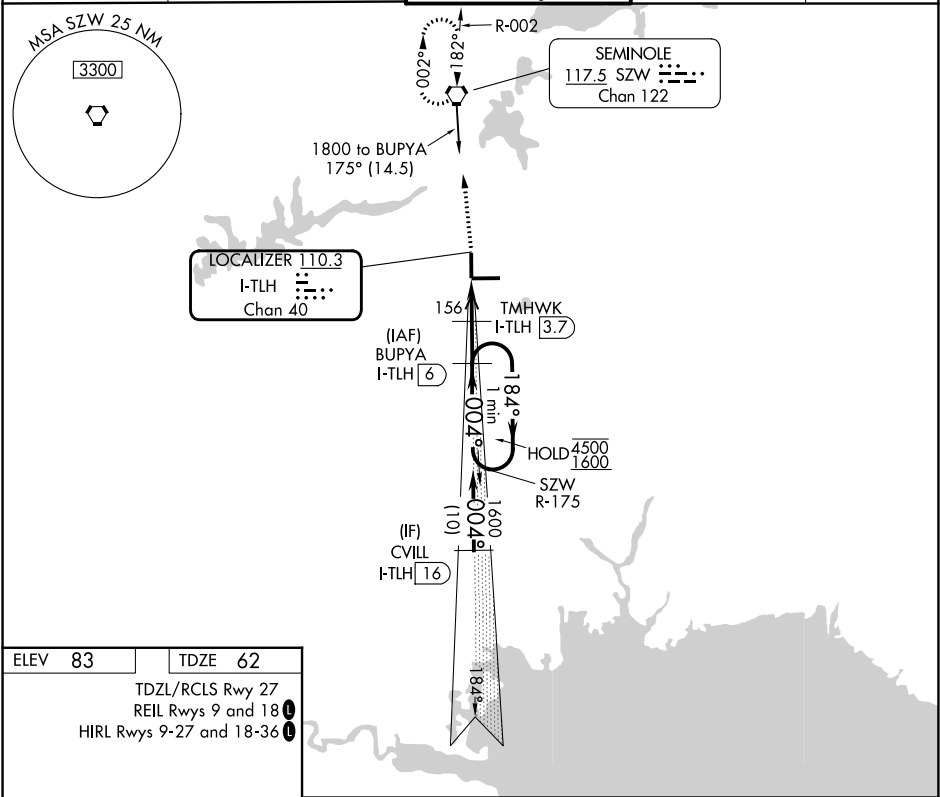

4000 SZW

One Minute Holding Pattern

TMHVK I-TLH 3.7

BUPLYA I-TLH 6

184° → 4500 / 1600

004° → 880 / 1600

GS 3.00° TCH 54

2.4 NM 2.3 NM

CATEGORY	A	B	C	D
S-ILS 36 *	262/24		200 (200-½)	
S-LOC 36	460/24	398 (400-½)	460/35	398 (400-¾)
CIRCLING	580-1 497 (500-1)	600-1 517 (600-1)	640-1½ 557 (600-1½)	800-2¼ 717 (800-2¼)

SE-3, 01 OCT 2026 to 29 OCT 2026

SE-3, 01 OCT 2026 to 29 OCT 2026