

ILS or LOC RWY 19R
WASHINGTON DULLES INTL (IAD)

MISSED APPROACH: Climb to 800 then climbing right turn to 3000 on heading 280° and AML VOR/DME R-264 to AMOSS INT/AML 20.4 DME and hold.



MISSED APCH FIX

116.3 CSN

264°


113.5 AML

Chan 82

AMOSS INT

AML 20.4

Chan 110

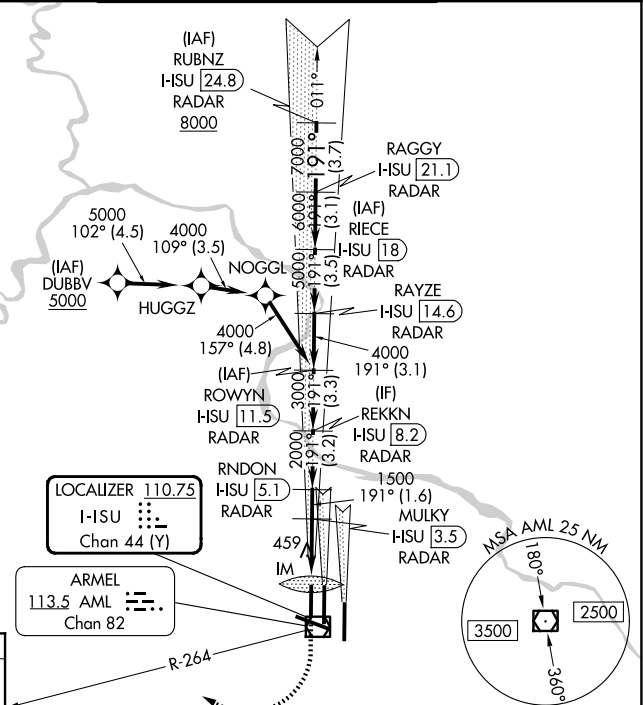

800 3000

↑ hdg 280°

AML R-264

AMOSS INT

REKKO HSI 8.2

RAYZE HSI 14.6

RAGGY HSI 21.1

RUBNZ HSI 24.8

MULKY HSI 3.5

RNDON HSI 5.1

ROWYN HSI 11.5

RICE HSI 18

1500 1500 2000 3000 4000 5000 6000 7000 8000

1500

GS 3.00° TCH 55'

VGSi and ILS glidepath not coincident (VGSi Angle 3.00/TCH 70)

WASHINGTON DULLES INTL (IAD)
ILS or LOC RWY 19R