
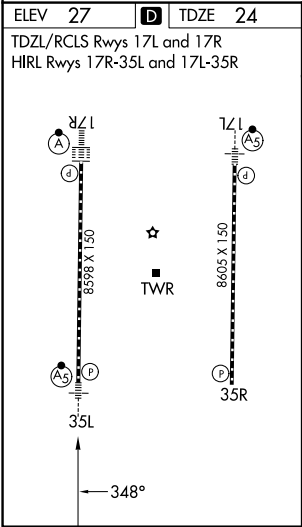
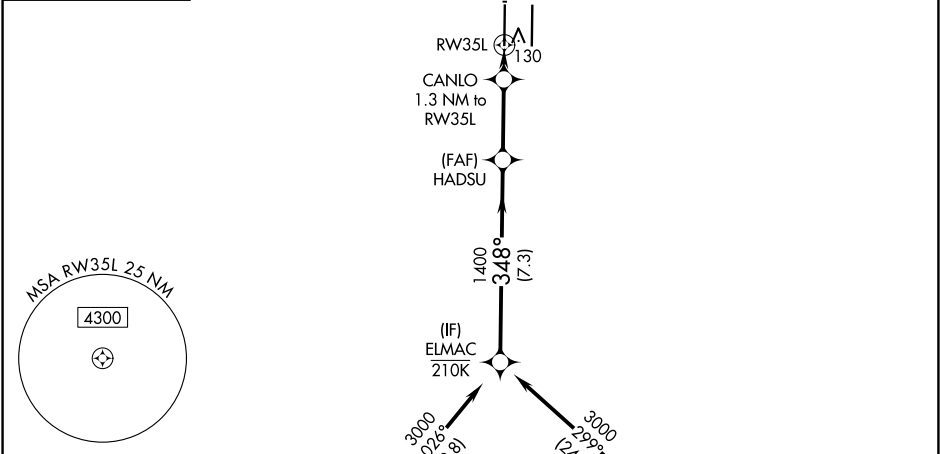


WAAS CH 86602 W35A	APP CRS 348°	Rwy Ldg TDZE Apt Elev 8598 24 27
--	------------------------	--

RNAV (GPS) Y RWY 35L

SACRAMENTO INTL (SMF)

RNP APCH-GPS. Circling NA east of Rwy 17R-35L. For uncompensated Baro-VNAV systems, LNAV/VNAV NA below -2°C or above 54°C. For inop ALS, increase LNAV/VNAV all Cats visibility to RVR 4500 and increase LNAV Cat C/D visibility to RVR 5500. *RVR 1800 authorized with use of FD or AP or HUD to DA.		MALSRL	MISSED APPROACH: Climb to 800 then climbing left turn to 2000 direct GRIME and hold.
D-ATIS 126.75	NORCAL APP CON 125.4 259.1 (W-NE) 125.25 257.9 (SW) 127.4 317.5 (E-SE)	CAPITOL TOWER 125.7 256.7	GND CON 121.7 256.7

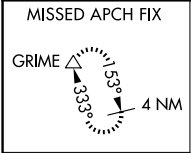

ELMAC		VGSi and RNAV glidepath not coincident (VGSi Angle 3.00/TCH 76).		800	2000	GRIME
3000		HADSU		1400	480	
GP 3.00° TCH 59		CANLO		1.3 NM to RW35L		
7.3 NM		2.9 NM		1.3 NM		
CATEGORY	A	B	C	D		
LPV DA*	224/24		200 (200-1/2)			
LNAV/VNAV DA	311/24		287 (300-1/2)			
LNAV MDA	380/24 356 (400-1/2)		380/30 356 (400-5/8)			
CIRCLING	440-1 413 (500-1)	480-1 453 (500-1)	480-1 1/2 453 (500-1 1/2)	580-2 553 (600-2)		