


VORTAC HLV	Rwy Ldg	5130
114.2	TDZE	817
Chan 89	APP CRS	253°
	Apt Elev	823


VOR/DME RWY 24
MEXICO MEML (MYJ)

NA Helicopter visibility reduction below ¾ SM NA. When local altimeter setting not received, use Columbia Rgnl altimeter setting and increase all MDAs 80 feet, increase S-24 visibility Cat C ½ SM and Circling visibility Cat C ½ SM. Inop table does not apply.	MALS A₂ MISSED APPROACH: Climbing left turn to 2300 via HLV R-073 to BOCOS/19.8 DME and hold.
--	---

AWOS-3PT 120.575	MIZZU APP CON 124.375	CTAF 122.9 0
---------------------	--------------------------	-----------------

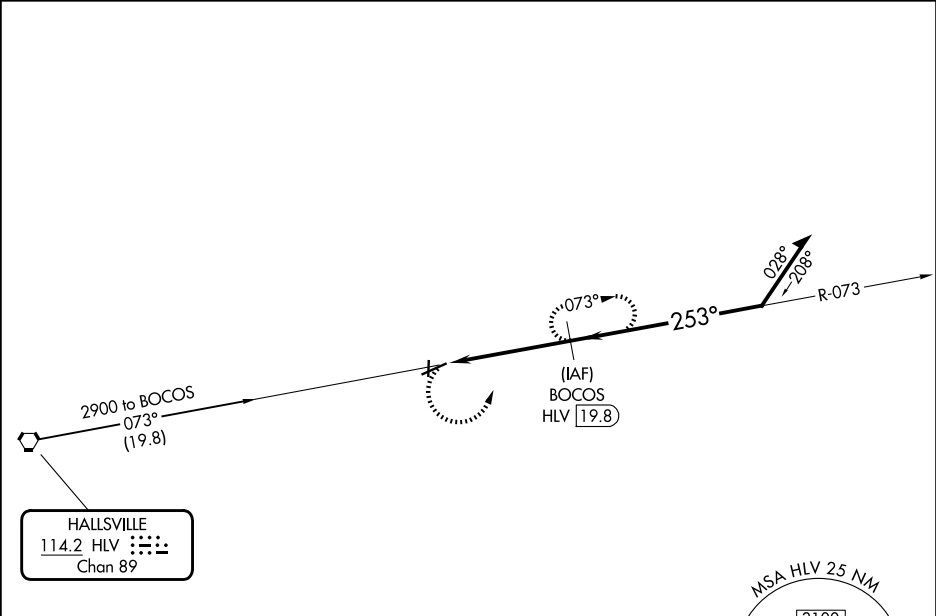

ELEV 823	TDZE 817
----------	----------

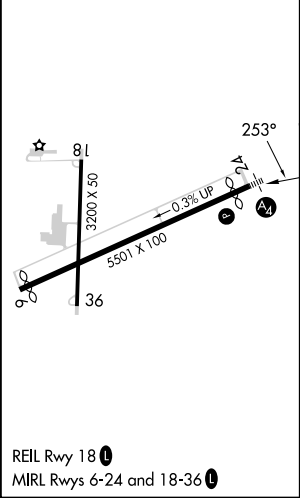

2300	HLV R-073	BOCOS HLV 19.8	BOCOS HLV 19.8	Remain within 10 NM
2300	HLV 15.2	253°	2300	2300
	4.6 NM	≤ 3.00° TCH 40		
CATEGORY	A	B	C	D
S-24	1220-1	403 (400-1)	1220-1¼ 403 (400-1¼)	NA
CIRCLING	1280-1	457 (500-1)	1420-1½ 597 (600-1½)	NA