

VORTAC RQZ

112.2

Chan 59

APP CRS

010°

Rwy Ldg

5500

TDZE

978

Apt Elev

984

VOR/DME RWY 2

FAYETTEVILLE MUNI (FYM)


▼

NA


When local altimeter setting not received, use Huntsville Exec Tom Sharp Jr Fld altimeter setting and increase all MDA 120 feet; increase S-2 Cat C/D visibility ¼ SM, Circling Cat C visibility ½ SM, and Circling Cat D visibility ¾ SM. Rwy 2 helicopter visibility reduction below ¾ SM NA.

MISSED APPROACH: Climb to 2000 then climbing left turn to 3000 via RQZ R-010 to JOYER INT and hold.

AWOS-3 135.275	HUNTSVILLE APP CON ★ 125.6 354.1	CLNC DEL (GCO) 121.725	UNICOM 122.8 (CTAF) 0
-------------------	-------------------------------------	---------------------------	--------------------------

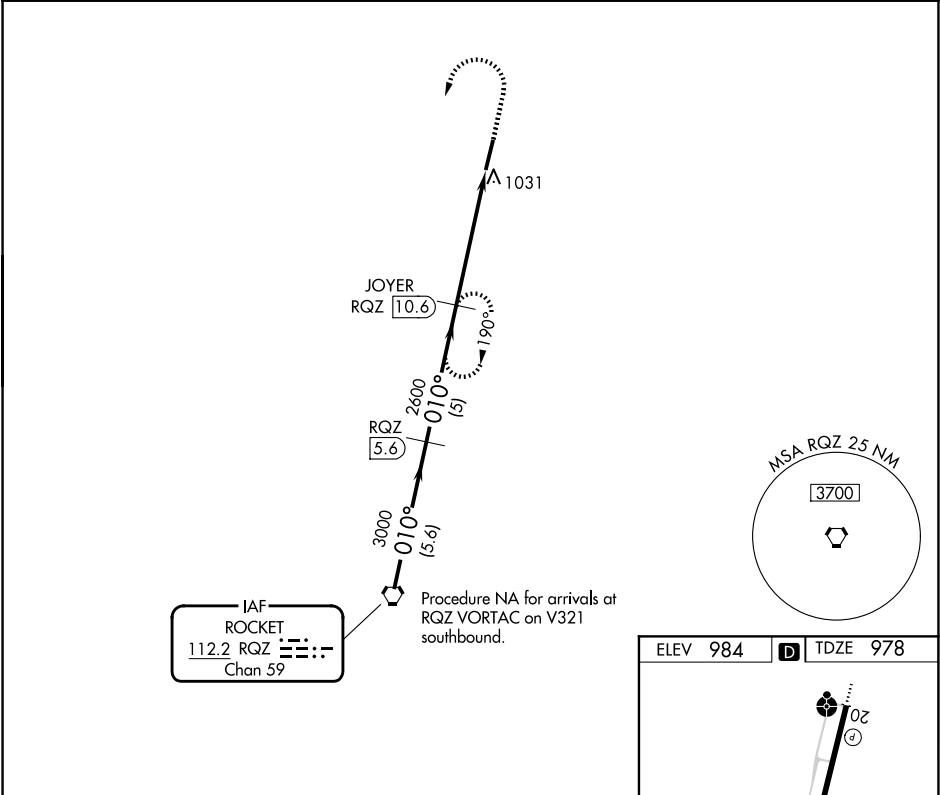

RQZ VORTAC		VGSI and descent angles not coincident (VGSI 3.00/TCH 22).		2000 3000 RQZ R-010		JOYER RQZ 10.6	
4000		RQZ 5.6		JOYER RQZ 10.6		RQZ 15.6	
Procedure Turn NA		010°		3000		2600	
		5.6 NM		5 NM		5 NM	
				3.00°		TCH 40	
CATEGORY	A		B		C		D
S-2	1400-1		422 (500-1)		1400-1¼ 422 (500-1¼)		1400-1½ 422 (500-1½)
CIRCLING	1420-1 436 (500-1)		1540-1 556 (600-1)		1580-1½ 596 (600-1½)		1580-2 596 (600-2)

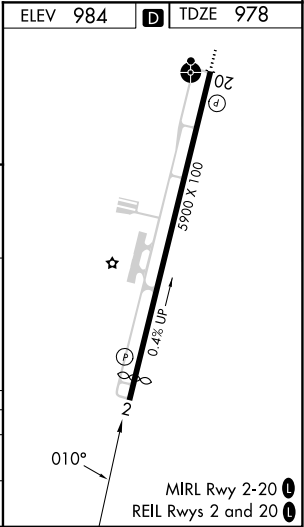

SE-1, 01 OCT 2026 to 29 OCT 2026

SE-1, 01 OCT 2026 to 29 OCT 2026