

KUSSO THREE DEPARTURE (RNAV)
(KUSSO3.KUSSO) 14MAY26

LONE STAR DEP CON
125.2 343.65
CTAF
122.7

RNAV 1 - DME/DME/IRU or GPS required.



RADAR required.

**TOP ALTITUDE:
ASSIGNED BY ATC**

TAKEOFF MINIMUMS

Rwy 13: Standard.

Rwy 31: 300-1¼ or standard with minimum climb of 210'/NM to 800, or alternatively, with standard takeoff minimums and a normal 200'/NM climb gradient, takeoff must occur no later than 1300' prior to DER.

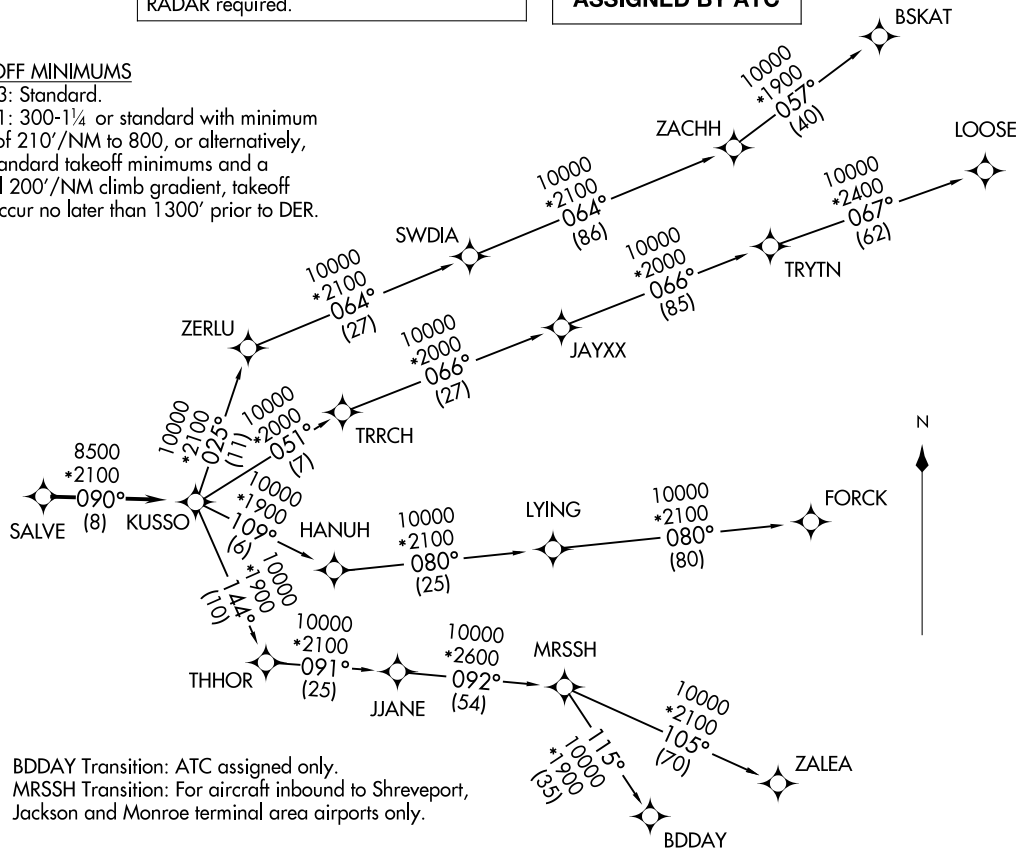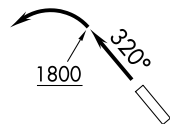

NOTE: BDDAY Transition: ATC assigned only.

NOTE: MRSSH Transition: For aircraft inbound to Shreveport, Jackson and Monroe terminal area airports only.

(CONTINUED ON FOLLOWING PAGE)


NOTE: Chart not to scale.

(KUSSO3.KUSSO) 26134
KUSSO THREE DEPARTURE (RNAV)

AL-5936 (FAA)

LANCASTER RGNL (LNC)
LANCASTER, TEXAS

LANCASTER, TEXAS
LANCASTER RGNL (LNC)

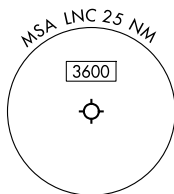



DEPARTURE ROUTE DESCRIPTION

TAKEOFF RUNWAY 31: Climb on heading 320° to 1800 before turning left.

When entering controlled airspace, fly heading assigned by ATC, expect RADAR vectors to SALVE, then on track 090° to KUSSO, then on assigned transition. Maintain ATC assigned altitude, expect filed altitude 10 minutes after departure.

- BDDAY TRANSITION (KUSSO3.BDDAY)
- BSKAT TRANSITION (KUSSO3.BSKAT)
- FORCK TRANSITION (KUSSO3.FORCK)
- LOOSE TRANSITION (KUSSO3.LOOSE)
- MRSSH TRANSITION (KUSSO3.MRSSH)
- ZALEA TRANSITION (KUSSO3.ZALEA)

SC-2, 01 OCT 2026 to 29 OCT 2026

SC-2, 01 OCT 2026 to 29 OCT 2026