

|         |          |      |
|---------|----------|------|
| APP CRS | Rwy Idg  | 3084 |
| 347°    | TDZE     | 574  |
|         | Apt Elev | 574  |

RNAV (GPS) RWY 35  
RALPH M HALL/ROCKWALL MUNI (F46)

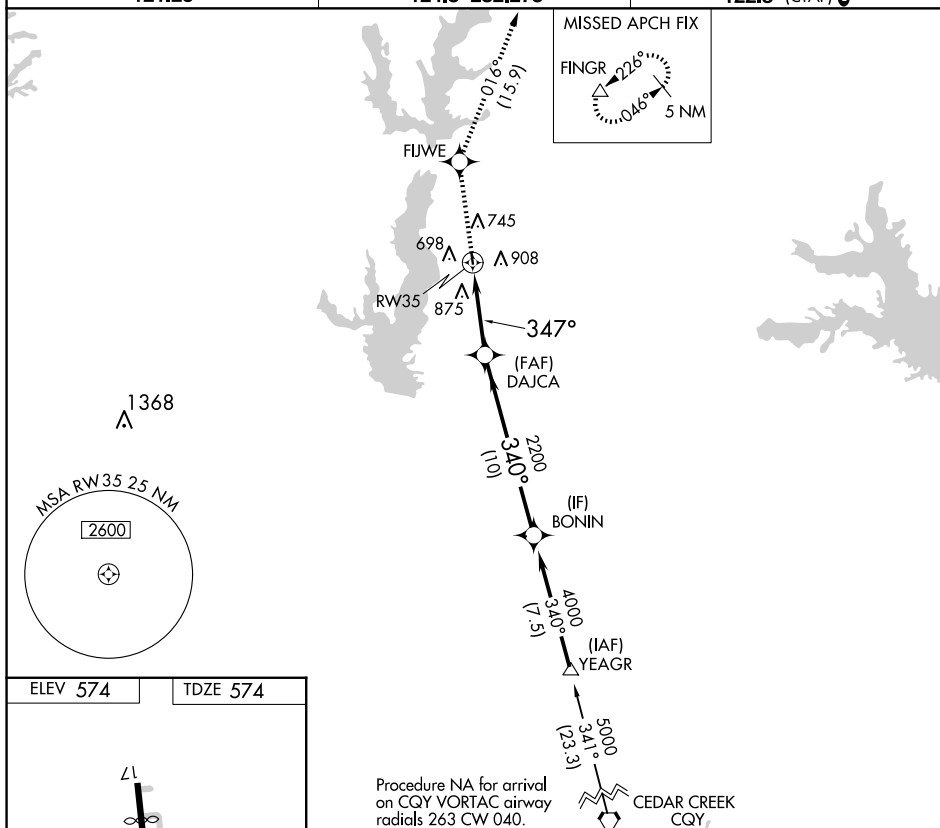
**T** DME/DME RNP-0.3 NA. When local altimeter setting not received, use Dallas Love Fld altimeter setting and increase all MDA 80 feet.

**A** Helicopter visibility reduction below 1 SM NA. Procedure NA at night.

MISSED APPROACH: Climb to 5000 direct FIJWE and on track 016° to FINGR and hold.

AWOS-3PT  
121.25

LONE STAR APP CON  
124.3 282.275

UNICOM  
122.8 (CTAF) 

ELEV 574

TDZE 574

Procedure NA for arrival  
on CQY VORTAC airway  
radials 263 CW 040.

|                                                                                     |                                                                                     |            |                                                                                     |
|-------------------------------------------------------------------------------------|-------------------------------------------------------------------------------------|------------|-------------------------------------------------------------------------------------|
| 5000                                                                                | FIJWE                                                                               | tr<br>016° | FINGR                                                                               |
|  |  |            |  |

BONIN

4000

DAJCA

$$\frac{\angle 3.00^\circ}{\text{TCH } 40}$$

1

2200

CATEGORY

A

---

---

D

LNAV MDA

1200-1 626 (700-1)

NA

CIRCLING

1280-1 706 (800-1)

NA

LIRL Rwy 17-35 L  
ROCKWALL, TEXAS  
Orig-C 30APR15

RALPH M HALL/ROCKWALL MUNI (F46)  
RNAV (GPS) RWY 35

32°56'N-96°26'W