KUSSO THREE DEPARTURE (RNAV)
(KUSSO3.KUSSO) 14MAY26

PEROT FLD/FORT WORTH ALLIANCE (AFW)
FORT WORTH, TEXAS

LONE STAR DEP CON
118.1 306.95
ATIS
126.925
CLNC DEL
128.725
GND CON
132.65 306.2
ALLIANCE TOWER
135.15 257.9

RNAV 1 - DME/DME/IRU or GPS required.

RADAR required.

TOP ALTITUDE: ASSIGNED BY ATC

TAKEOFF MINIMUMS
Rwys 34L/R: Standard.
Rwys 16L: 300-2¼ or standard with minimum climb of 220'/NM to 1100, or alternatively, with standard takeoff minimums and a normal 200'/NM climb gradient, takeoff must occur no later than 1900' prior to DER.
Rwys 16R: 300-2¼ or standard with minimum climb of 225'/NM to 1100, or alternatively, with standard takeoff minimums and a normal 200'/NM climb gradient, takeoff must occur no later than 2000' prior to DER.

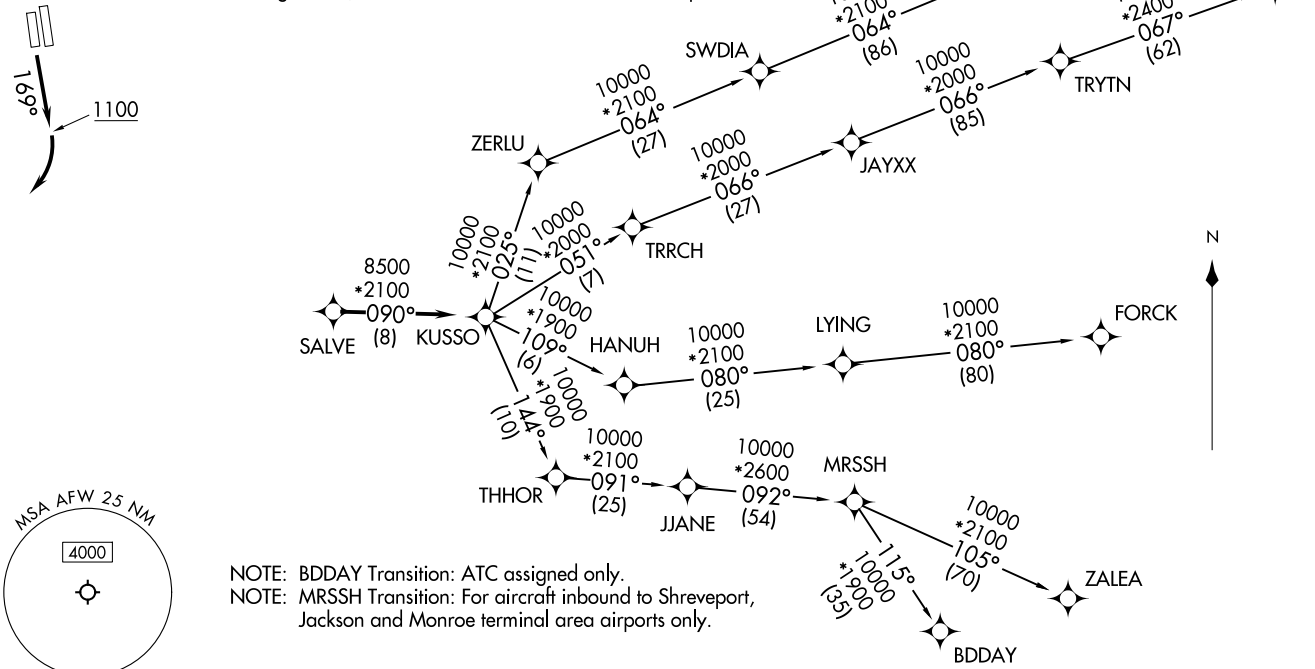

NOTE: BDDAY Transition: ATC assigned only.
NOTE: MRSSH Transition: For aircraft inbound to Shreveport, Jackson and Monroe terminal area airports only.

(CONTINUED ON FOLLOWING PAGE)

NOTE: Chart not to scale.

(KUSSO3.KUSSO) 26134
KUSSO THREE DEPARTURE (RNAV)
AL-6918 (FAA)
PEROT FLD/FORT WORTH ALLIANCE (AFW)
FORT WORTH, TEXAS

DEPARTURE ROUTE DESCRIPTION

TAKEOFF RUNWAY 16R: Climb on heading 169° to 1100 before turning right.

When entering controlled airspace, fly heading assigned by ATC, expect RADAR vectors to SALVE, then on track 090° to KUSSO, then on assigned transition. Maintain ATC assigned altitude, expect filed altitude 10 minutes after departure.

BDDAY TRANSITION (KUSSO3.BDDAY)
BSKAT TRANSITION (KUSSO3.BSKAT)
FORCK TRANSITION (KUSSO3.FORCK)
LOOSE TRANSITION (KUSSO3.LOOSE)
MRSSH TRANSITION (KUSSO3.MRSSH)
ZALEA TRANSITION (KUSSO3.ZALEA)

SC-2, 01 OCT 2026 to 29 OCT 2026