


26078




ILS RWY 34L (SA CAT I)
DENVER INTL (DEN)

MISSED APPROACH: Climb to 5800 then climbing left turn to 11000 on heading 270° and on FQF VORTAC R-306 to HYGEN/FQF 37.9 DME/RADAR and hold.

T Requires specific OPSPEC, MSPEC, or LOA approval. Simultaneous approach authorized.

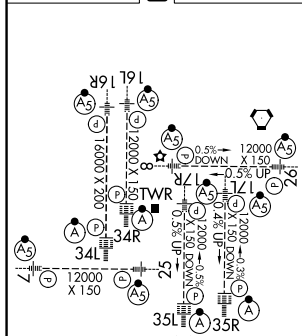

HIRL all Rwys
TDZL/RCLS Rwys 7, 16L, 16R, 17R, 26,
34L, 34R, 35L, 35R

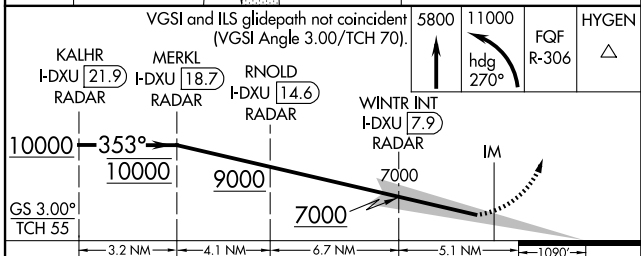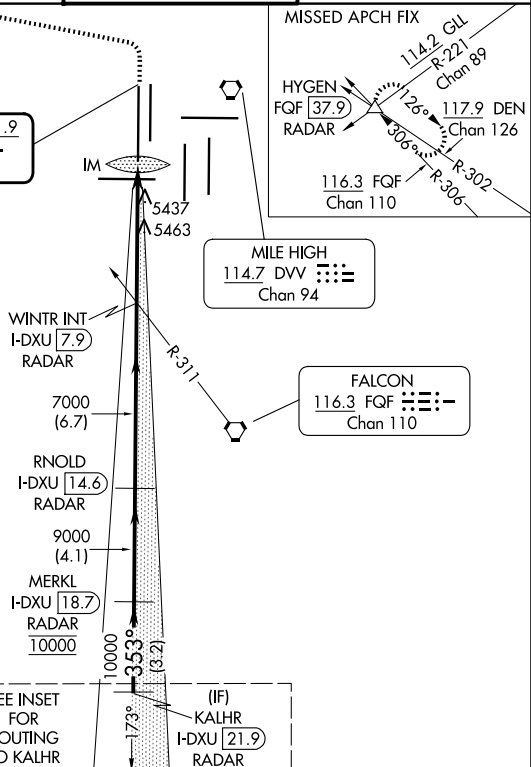

SA CATEGORY I ILS - SPECIAL AIRCREW
& AIRCRAFT CERTIFICATION REQUIRED

39°52'N-104°40'W

DENVER INTL (DEN)
ILS RWY 34L (SA CAT I)

SW-1, 01 OCT 2026 to 29 OCT 2026